

COPY

# LLOYD'S REGISTER OF SHIPPING

UNITED WITH THE BRITISH CORPORATION REGISTER



Port OF ISTANBUL

+ 100 A1

28th March 1961

### This is to Certify that


G. J. BOULTER

the undersigned Surveyor to this Society did at the request of the Owners' Agents Messrs, Kanakaris ve Mahdumi, attend aboard the hulk World Harmony, on receipt of information that a fracture had occurred in upper deck plating starboard side of poop passage way as she lay afloat in Beykoz Bay 25th March 1961.


A crack approx. 4 ft long was found at the forward corner of the Engine Room casing in upper deck in poop, running at approx 45° to centre line forward and outboard.

The Owners' agents have been again advised that the recommendations made for a ballast condition, giving reduced Bending Moments, was detailed in the Secretary letter of 6th January 1961. should be carried out. i.e. No.1 Std. tank emptied, No.10 C and 10 S tanks filled and approx 1500 tons of water put in No.8 C tank.

G. J. BOULTER  
Surveyor to Lloyd's Register

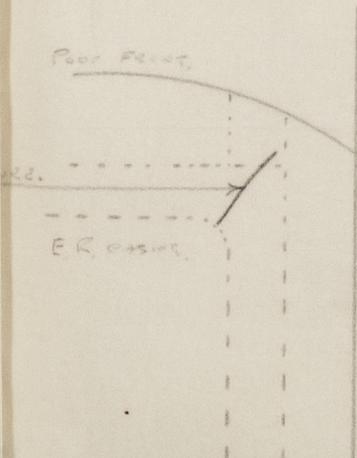

Certificate is issued upon the terms of the Rules and Regulations of the Society, which provide that:—  
The Committees of the Society use their best endeavours to ensure that the functions of the Society are properly performed; it is to be understood that neither the Society nor any Member of any of its Committees is under any circumstances to be held responsible for any inaccuracy in any report or certificate issued by the Society or its Surveyors, or in any entry in the Register Book or other publication of the Society, or for any error of judgment, default or negligence of any of its Members or any Member thereof, or the Surveyors, or its Officers or Agents of the Society.

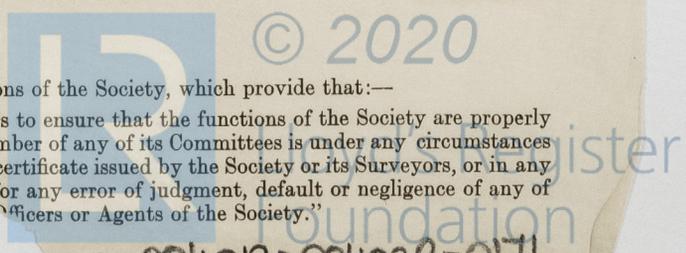

004019-004028-0171