

Steam Trawler "HARGOOD"

Repairs (contd.)

660 lbs/sq.in. and found in order. Main check valve chest renewed; new chest hydraulically tested to 550 lbs/sq.in. and found in order. Air pump bucket rod and feed pump plunger skimmed and rebushed. Bilge pump plunger renewed. A number of plain and stay tubes renewed in the boiler.

On completion of the overhaul, the main and auxiliary machinery, pumping arrangements were examined under working conditions and found satisfactory.

During the L.M.C. Survey, the vessel was converted from coal to oil burning. The oil burning installation was fitted in accordance with the Secretary's letter "E" dated 29/9/49, approved plans and Section 19 of the Rule requirements for steel trawlers. The installation on completion was examined in accordance with Circ.No.1748 and found in order; it is recommended that the notation of "Fitted for oil fuel 12,49 F.P.above 150°F." be made in the Register Book.



© 2020

Lloyd's Register
Foundation