

WRECK
STATION

(Received at London Office [8-APR 1957])

No. 770

REPORT OF SURVEY FOR REPAIRS, &c.

Writing Report... 16/3/57... 19... When ended in at Local Office 22/3/57... 19... Port of VALENCIA
in Survey held at Cartagena Date, First Survey 11/3/57 Last Survey 14/3/57 19...
Book. on the Wood, Iron or Steel "TAJUÑA" (No. of Visits... 4...)

684 TONNAGE :- Built at Haverton Hill By whom Furness S.B.Co.Ltd. When 3-1921
Gross 4648 Owners Marítima Madrileña, S.A. Owners' Address -
Net 2812 Managers - Port belonging to Bilbao
(It not already recorded in Appendix to Register Book).

Keel Afloat or in Dry Dock? Afloat Name of Dock Cartagena Destined Voyage -
Depth of Water - feet; uE & B - feet; f - feet
Capacity - tons. FPT - tons; APT - tons; MT - feet - tons.
Only alterations in the existing records of tanks should be inserted.

N.B. - All alterations in the existing records should be underlined.
Last Report, No. 762 Port Val

Particulars of Classification (which must be inserted precisely as in Register Book & Supplements)
CHARACTER: * for Special Survey. Date of last Survey and of Periodical Surveys.
+100AI 11,55 +LMC 11,54
Shltr.dk.with Fbd. BS 11,55
SS (Dr) 2,45 CL 11,55
SS Bbo. 11,54 Steam pipes 11,54
Reclassified 11,54 O.F. 11,54

Image cases where the Surveyor has not made a special damage report he is required to state whether he offered his services for this purpose and to whom and why they were declined Yes - Owners
Society's Freeboard (if assigned) as painted on Ship and now verified } - ft. - ins.

Not required Was a damage report made by anyone else? if so, by whom? Unknown
Repairs, OR EXAMINATION AS PER RULE, FOR DAMAGE stated to have been caused by collision with destroyer GEORGE JUAN at Cartagena on the 9th March 1957.

WORK DONE:- Vessel examined afloat. Starboard forward side shell examined.

DAMAGE REPAIRS:-
SHELL (Numbered from forward):
Cropped and part renewed: Sheerstrake No 2
1st below " No 3 (starboard)
Faired in place: 2nd " " No 2 (starboard)
2 frames cropped, removed, faired and replaced.
2 beam knees removed, faired and replaced.
Shell hose tested on completion of repairs and proved satisfactory.

STATE OF DAMAGE REPAIRS :-	Shell Plates.	Frames.	R. Frames.	Floors and Bracket Floors	Beams.	Inner Bottom Plates.	Dk. Plates.	Other Items :-
Renewed	2(part)2(part)							2 beam knees removed, faired and replaced.
Removed and Faired or Repaired	-	-						
Faired or Repaired in place ...	2	-						

GENERAL CONDITION OF THE	Bulkheads	Engine Room Skylights	Copper, or Y.M.
Plating of Decks	Ceiling	Coal Bunkers, Openings, Covers, &c.	(State if on Felt.)
Frames & Fastenings <u>SURVEY</u>	Cement or Asphalt	Oil Bunkers	When fitted, Month Year
Plating	Rudder	Scuppers	Boats
" In way of sidelights	Steering gear and its connections	Cargo Hatchways	Masts, Yards, &c.
Frames	Windlass	Hatches	Condition, how ascertained (State if wedges removed.)
Longitudinals	Have pumps been examined and found efficient? <u>CONFINED</u>	Planking	Equipment letter
Transverse	Have Sluice Valves been examined and found efficient?	Caulking	Anchors, No. of
Bottom Plating	Have Watertight Doors been examined and found efficient?	Treenails	Cables (State if now ranged)
Oil Tanks been examined internally?	Have Ventilators and their Coamings been examined and found efficient?	Breasthooks & Stems <u>AS STATED</u>	" length mean diamr. (on board.)
Water Tanks been tested?	Air and Sounding Pipes	Transoms, Pointers & Crutches	" Rule length size
	Doubling Plates under Sounding Pipes	Timbers of Frame at openings	Chain Locker
		" " at other places	Hawsers & Warps <u>ABOVE</u>
		Stringers, Clamps & Shelves	Standing and Running Rigging
		Salting	Sails
		State if examined	

General Observations, Opinion as to Class, Recommendation, &c.:
State clearly whether any and, if so, what alteration is suggested to be made in the existing classification and notification of the vessel in the Register Book consequent upon this survey, thus, for example: - "to remain as classed in the Register Book without fresh record of Survey," "to remain as classed and to have record of survey, 1,38," or "to remain as classed and to have record of survey, 1,38, and the notations of as No. 1-38."
This vessel, so far as now seen, is eligible in my opinion to remain as now classed at fresh record of survey and subject to all conditions at present attached to the ship's being dealt with as previously recommended.

Fees (per Section 23) Pts. 2,000/-
Damage or Repair Fee (if any) :
Expenses (if chargeable) Pts. 1,300/-
Surveyor's Fee (if any) Pts. 1,000/-
Fees applied for, 21/3/57
Received by me, - 19
A.B. McQueen For E. Montalbo.
Surveyor to Lloyd's Register of Shipping.

Committee's Minute THURSDAY 25 APR 1957
Character Assigned AS NOW Subject
Lloyd's Register Foundation
004263-004274-0061