

004477-004480-0261

23 MAR 1967

Ship's name

"AL HUSAINI"

Port

Krh.

No. 1399Last survey date 10.2.67Class is subject to

For condition of class see previous endorsement.

S.R.L. Appendix (as ~~before~~ or none)Nature of present survey (afloat and in drydock)*Reason of deferred items
further temporary repairs*

TO NOTE		TRO
S. PLANS	S. RESEARCH	S. DEVELOP.
FREEBOARD	E. REPORTS	PUBS.

Recommendation

SUBJECT to a bower anchor (supplied Bal.3.65) being coupled up and verified with certificates at the earliest opportunity and to indented shell plate in 1st & 2nd strakes below sheer (s) in way of after end of No.1 'tween deck being specially examined and dealt with as necessary next drydocking (DEFERRED S.S. REPAIRS), and to repairs to fractures in shell plates G.2 (p & s), G.3 (p) also indented plates in 3rd strake below sheer at after side of E.R. and forward deep tank (s) and set over sheerstrake and stringer angle on round of poop and temporary repairs to fracture in shell plating in way of deep tank top and No.1 hold (p) also wasted shell plates D.3, 4 & 5 (p) and temporary repairs to bilge brackets (p), H.2 & 4 (p from a) F.3, G.3 & 4 (s from a) set up shell plates A.9 & 10, B.6 & 7, C.3 & 4 (s) A.9 & 10, B.6, C.3 & 4 (p) being specially examined and dealt with as necessary next drydocking.

As Now. Subject.
End. S.1

13/3/67