

SL Ship's name

"AL HUSAINI"

Port

CHG

CAL

CHG CABLE 4.10.65.

773

No. 1925

Last survey date 5.8.65

Class is subject to

For conditions of class see previous endorsement.

S.R.L. Appendix (as ~~before~~ or none)

Nature of present survey (afloat ~~and in dock~~)

Permanent and temporary repairs to damage (contact).

Recommendation

SUBJECT to a bower anchor (supplied Bal. 3,65) being coupled up and verified with certificates and 30 fathoms of chain cable placed on board Bal. 3,65 being replaced by chain cable of rule size and test at the earliest opportunity, and to indented shell plating in 1st and 2nd strakes below sheer (s.s) in way of aft end of No.1 'tween deck being specially examined and dealt with as necessary next D.D. (Deferred S.S. repairs) and to wasted rudder trunk plating being specially examined and dealt with as necessary by 10.65 and to repairs to fractures in shell plates G.2 (p&s) G.3 (p.s) being specially examined and dealt with as necessary next D.D. also to structure fwd. (s.s) indented plates in 3rd strake below sheer at after side of E.D. and fwd. Deep tank (s.s) and to set over sheerstrake and stringer angle on round of poop being specially examined and dealt with as necessary by 11.65.

SUBJECT Amended.

End. S.1

004477-004480-0332

Foundation
11-10-65