

V

13 DEC 1945

1m.9.45.

Received by Chief Ship Surveyor.....

Received from Chief Ship Surveyor.....

VESSEL'S NAME "EMPIRE TAGINDA" REPORT Lon. No.113277

The remarks of the Chief Ship Surveyor are desired on this case for the consideration of the Classing Committee.

("The endorsement to contain a succinct summary of any repairs that have been required and to show the cause or causes of such repairs, and also to bring out clearly any exceptional features in connection with the case, so that the Classing Committee may have all the salient points presented in the endorsement."—Extract from Sub-Committee's Report, 24/5/92.)

This ex-German tanker built 1922 was formerly classed with Germanischer Lloyd.

The LONDON Surveyors report the vessel placed in dry dock, bottom coated and a GENERAL EXAMINATION held.

The Surveyors point out that floors etc. in D.B. tank under engines and boilers show signs of considerable wastage. Some repairs and renewals have been effected to floors etc. and temporary repairs (cement) effected in way of leakage at margin plate of the two after D.B. tanks (p & s).

The Surveyors recommend D.B. tanks under E & B space be further examined at the next GENERAL EXAMINATION.

Repairs effected to (wasted) upper deck plating in way of bridge and to minor items.

IT IS SUBMITTED the vessel is eligible to have record of docking survey 10.45 and to have the notation "Examined L.R.10.45" as recommended assigned. D.B. tanks under E & B space to be specially examined at the next GENERAL EXAMINATION. Permanent repairs to margin plate of two after D.B. tanks, (A bower anchor and 30 fathoms of chain cable to supply).

10.45 Lon. subject

"Examined L.R. 10.45"

23.11.45 [Signature]



© 2021

Lloyd's Register Foundation