

4 JUN 1965

Ship's name PAKISTAN PROMOTER Port Karachi No. 800

Class is subject to

Last survey date 17.4.65.

- 1 Propeller rubber ring sealing ring gland studs being examined & dealt with and stern bush lining being renewed by 12.64 (3 mos).
- 2 Centre boiler aux. feed check valves being renewed on completion MBS & by 12.64 (3 mos).

MBS due 7.64, commenced 9.64 now advanced.

SRL - Subject item 2 now dealt with by renewal of check valve - to delete.

Subject item 1 - now specially examined - propeller rubber ring sealing ring gland studs examined & found to continue efficient meantime. Wear down of stern bush checked & found to be 7.5 mm. Surveyor states that no abnormal leakage of stern gland has been reported & there are no reports of vibration. Surveyor recommends limit on Item 1 be extended to 6.65.

Surveyor reports that about 25% of plain tubes of Low boiler are in leaking condition and 75% of superheater elements are inefficient. — no repairs earned out (Cur)

0371 2/3

E-4 JUN 1965

Ship's name

Port

No.

Last survey date

Class is subject to

to plain tubes & all superheater elements removed & superheater headers blanked.

Surveyor recommends that Two boilers not be used until defective plain tubes have been renewed

Starbd feed pump water end cracked in way of threaded inspection plug opening. Now repaired by metalock, examined under hydraulic test & found satisfactory meantime. Surveyor recommends that metalock repairs to Starbd feed pump be specially examined by 7.65

It is submitted that the vessel **WILL BE** eligible for the record **MBS 9.64** when the survey has been completed.

RB $\frac{3}{6.65}$

without condition 2

subject as now amended and as now recommended.

RB to note — now 3 SB 250 lbs 5p! 1 SB 250 lbs

SRH to note — Steam pipes in smoke boxes of Fwd Bldg to remove first off

Ship's name

Port

No.

Class is subject to

Last survey date

To complete MBS for 9.64.

Safety valves of two boilers to adjust.

Subject item re two boilers to be dealt with.

Advise Surveyor that as it would appear that ~~the~~ the Superheater elements of the two boilers have been permanently removed, it is considered that the steam pipes in the smoke boxes of two boilers should be removed. A note is being inserted in SRL Appendix "Steam pipes in smoke boxes of two boilers to be removed at first opportunity."

