

Ship's name "SALAMMANNA"Port

RIO

No. 2602Last survey date 25.5.64.

Class is subject to indented shell plate in way of No.4 hold (s.s) and structure in way and to indented sheerstrake and plating in 1st below in way of No.5 hold (s.s), to indented shell plate in 'A' strake in way of No.6 D.B. tank (s.s) and keel plates aft and shell plate in way of No.1 hold bilge (p.s.s) (cement box fitted) being specially examined and dealt with as necessary next drydocking.

S.R.L. Appendix (as before or none)Surveys due SPECIAL SURVEY (C) due 4.64.Nature of present survey (afloat and in drydock)

Docking: Temporary repairs to damaged bottom shell plating due to grounding.

Is interim certificate in order

Yes/No/None

Items outstanding if any for SS

ALL ITEMS.

SS proposed to be completed byRecommendation

SUBJECT as above and to permanent repairs to buckled and set up stem, keel and bottom plating etc. (p. & s) in way of fore peak, Nos.1 & 2 D.B. tanks being specially examined and dealt with as necessary on completion of present voyage to the U.S.A.

As Now Subject.

IN S.R.L. APPENDIX

Indents in side shell plating (p & s).  
Poop side (p.s) indented.



© 2021

Lloyd's Register  
Foundation