

Rpt. 8

REPORT OF SHIP SURVEYS AND REPAIRS

Received London

1 OCT 1962

Ship's Name SS/xxx

"BOUNDARY"

Gross tons 905

Is there a rpt. 9? No

Port DURBAN

Rpt. No. 9976

No. of visits One

First date and

Last date 22-9-62

Interim Cert. issued
copy herewith? YesDamage rpt. issued
& copy herewith? No

Last rpt. (H.Q. only)

Date of
completing rpt. 24-9-62

Surveyed at, if different from Port above -

Surveyed afloat
and/or in D.D. Afloat

Last date of examination in D.D. -

as a Load Line
survey been held? No

Freeboard Marks verified -

State which additional Rpt. 8 is attached: (Cont); (PS); (DR); (EQ); (Rig)

Survey fees R14 - 00

Damage fee

Expenses R0 - 85

S.A. fee

I have surveyed the above ship in accordance with the Rules for issue of an Interim Certificate.

Items now surveyed are detailed on this report. All were found or placed in good condition unless otherwise stated. It was reported that leakage had developed in way of the after hold.

On examination it was found that local corrosion had taken place at the shell plating adjacent to the upper end of the 3rd shell frame from the after bulkhead on starboard side of the after hold.

The corroded area approximately 2 1/2" x 8" was holed at one place and had been patched by the ship's staff by means of a bolt, grummett and washer.

It was recommended that a welded doubler be fitted in way of the corroded area before loading another cargo.

The ship is laid up meantime, pending Owners decision whether ship will continue trading or be sold for scrap.

A letter to Secretary dated 22nd September, 1962.

RE: The corroded area was apparently caused by a started shell rivet in frame, the shell plate in vicinity is set in. Remainder of shell plating sound.

I recommend that this ship remain as classed ~~xxx~~ without fresh record of dry docking, subject to further repairs, in way of defective shell plate, starboard side, after end, of after cargo hold, before loading another cargo.

Where conditions of class are recommended to be retained, imposed, amended or deleted, particulars must be stated above and on the interim certificate.)

Date of Committee

WEDNESDAY 10 OCT 1962

Minute

As now subject

Write Down

Surveyor to Lloyd's Register of Shipping

ALSO FOR

SPL FOR

TRO

SRL

POSTING

HEADER

CERT

Lloyd's Register
Foundation

004900-004905-0159