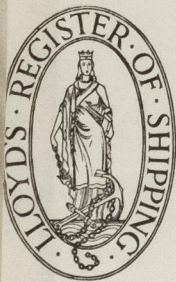


LLOYD'S REGISTER OF SHIPPING

1612

Port TRINIDAD, W.I.August 7/59S.S. MARSELLA2698 gross tons of Trinidad

This is to Certify that

C.G. PURVIS

the undersigned Surveyor to this Society did at the request of the Owner's Representative and instructed by Lloyd's Agents attend the above vessel on August 6/59, whilst lying afloat at this port, for the purpose of ascertaining the nature and extent of damage alleged to have been sustained on August 5/59, in consequence of being rammed by the M.V. JULIANE SCHRODER in the outer harbour of Port of Spain.

For further particulars see the vessel's log books.

Upon examination at this time the following damage was found which, in the opinion of the undersigned, is attributable to the alleged cause. The following recommendations were made without prejudice to the terms and conditions of the Policies of Insurance.

FOUNDRECOMMENDEDSHEER STRAKE PLATING IN WAY OF NO. 1 PORT WING TANK

The upper edge of No. 4 Plate set in approx 6" over a length of 3'-0 and the gunwale bar in way buckled & fractured.

Approx 3'-0 x 1'-0 of No. 4 plate to crop and renew together with the rivetted gunwale bar in way.

The upper edge of No. 5 plate set in approx 4" over a length of 2'-0 and the gunwale bar in way buckled and distorted.

Approx 2'-0 x 1'-0 of No. 5 plate to crop and renew together with the rivetted gunwale bar in way.

The deck plating in way of the above damage sheer strake plating distorted and fractured along the gunwale bar.

Approx 6'-0 x 1'-0 of deck plate to crop and renew.

Note. This area of plate extends over the adjacent damages to Nos. 4 & 5 sheer strake plates.

GENERAL - Necessary gas freeing, removals and replacements to effect repairs. All new and disturbed work to be coated as original.
Note All plates numbered from forward.

The above recommendations were deferred until the vessel's next drydocking. At this time a suitable concrete box was fitted over the fractured deck plating.

This Certificate is issued upon the terms of the Rules and Regulations of the Society, which provide that: "While the Committees of the Society use their best endeavours to ensure that the functions of the Society are properly executed, it is to be understood that neither the Society nor any Member of any of its Committees is under any circumstances to be held responsible for any inaccuracy in any report or certificate issued by the Society or its Surveyors, or in any entry in the Register Book or other publication of the Society, or for any error of judgment, default or negligence of any of its Committees or any Member thereof, or the Surveyors, or other Officers or Agents of the Society."