

27 JUL 1965

Ship's name "TASSIA"

Port PIR

No. 11689

Class is subject to :-

Last survey date 5.5.65.

1. Evaporator not being used until surveyed.
2. IP piston valve (M/L 4.64. & 12.64.) be specially examined by 12.65.

Subject Item 2 :- Now renewed. The Surveyor recommends this Condition be deleted.

Docking :- Oil gland tight.

MBSV :- Due 4/65, now held.

SPS :- Due 6/66, now held.

ES :- Due 5/65, commenced 4/64 now advanced.

The Surveyor reports the main boiler safety valves were not lifting and closing satisfactorily this condition being attributed to the springs renewal being deferred until arrival in the U.K. where spares would be readily available. He recommends that the safety valve springs of both main boilers be renewed before the end of June, 1965.

The Surveyor reports the alt F.W. heater replaced by a tested used one and a number of other wear & tear repairs. JSNHL 23/7 Rpm H

© 2020

Lloyd's Register  
Foundation  
(continued)  
005174-005179-0294 1/2



Ship's name

"  
TASSIA"

Port

Pir.

No.

11689.

Class is subject to

(continued).

Last survey date

The Surveyor reports attached bilge and G.S. pumps disconnected but adequate alternative arrangements exist.

It is submitted that the vessel WILL BE eligible for the record SPS  $\frac{5}{65}$  now and ES  $\frac{5}{65}$  and MBS  $\frac{5}{65}$  when the survey has been completed. subject as before for Item 1 without Item 2 and as now recommended. 26.7.65.

To complete MBS  $\frac{5}{65}$ .

Main boiler Safety valve Springs to be renewed.

To complete ES.  $\frac{5}{65}$

The diesel generator engine remains to be examined.

SRL Appendix to note. M.E. attached pumps disconnected  $\frac{5}{65}$ .

Fbd. Surveyors to note fire extinguishing deficiencies.

The Surveyor should be informed that protection for the boiler water level gauge glasses should not have been made a Condition of Class and an amended Interim Certificate should be issued to which it may be necessary to amend the recommendation re. fire extinguishing arrangements after consideration by Fbd Surveyors.

Smt 4/8/65

X15/7

0294 2/2