

MR. TURNER


REMEDIOS

Re classification survey

The drillings reported by the Barcelona Surveyors have been examined and the renewals of side shell plating proposed by the Surveyors are considered to be in order, with the exception that the plates in H strake port and starboard in way of No. 7 tank and in J strake port in way of No. 1 tank should also be renewed, as the original thickness of these strakes would appear to be 13.5 mm and 14.2 mm respectively.

The drillings of the deck plating as given on the plan received with Barcelona Report 6837 have been examined and the proposed renewals are concurred in with the exception that the plates in the second strake from the stringer on the port side in way of Nos. 5 and 6 tanks (reported drilling 6.8 mm. in each case) should be renewed.

Note: No bottom shell drillings available at this time.


24th September, 1958.



© 2021

Lloyd's Register
Foundation

005210-005218-0074