

Received by Chief Engineer Surveyor.....

Received from Chief Engineer Surveyor.....

4E

20 JUL 1958

IP'S NAME..... SETTSU

REPORT Milford Haven

No. 8371

M.B.S. due 9.58 daily Ldld row

Main boiler examined at the request of the Owners on account of leakage in the port wing furnace and several fractures located; also, the starboard furnace examined on the fire side and found fractured as per port furnace.

Internally the combustion back plates were found in poor condition, and the Surveyor recommends these be cropped and part renewed, also approximately 70 combustion chamber screwed stays require renewal.

The Surveyor recommends that the lower combustion chambers wrapper plates be drill-tested and the combustion chamber girders and crowns be scaled for further examination.

The Surveyor recommends that the class be retained subject to the main boiler not being used until permanently repaired, and the Boiler Survey completed.

JH

28.7.58



© 2020

Lloyd's Register
Foundation

005403-005411-0140