

REPORT OF SURVEY FOR REPAIRS, &c.

Date of writing Report July 3rd 1941 When handed in at Local Office July 3rd 1941 Port of San Nicholas, Cuba, N.W.I.No. in Reg. Book. Survey held at San Nicholas, Cuba, N.W.I. Date, First Survey June 25th Last Survey July 2nd 1941 (No. of Visits Two)1796 on the ~~Steel~~ M.V. "CARIPITENO" By whom Schiffw. Manuel Lindemann & Co. When 1934. 5TONNAGE: Built at ~~St. Louis~~ Managers ~~St. Louis~~ Owners' Address ~~St. Louis~~ Port belonging to ~~St. Louis~~

GROSS 475 UNDER DEK. 265 NET 225

Surveyed Afloat or in Dry Dock? ~~Surveyed~~ Name of Dock Marine Rm. Destined Voyage ~~boasting~~

Cell D B or D B a feet; u E & B feet; f feet

total capacity tons. FPT tons; APT tons; MT feet tons.

Only alterations in the existing records of tanks should be inserted.

N.B.—All alterations in the existing records should be underlined.

Last Report, No. 7461. Port L.A.

Particulars of Classification (which must be inserted precisely as in Register Book & Supplements)

CHARACTER. Date of last Survey and of Periodical Surveys. Machinery and Boiler Surveys (including date of N.B., in any).

+100A1 with pressure. 4.39 T.S. 8.58

S.S. Am. 1st - 38 N. 3.39 TS.

For Venezuela Coastwise Service. oil bps

Cargo Battens not fitted in after hold

In damage cases where the Surveyor has not made a special damage report he is required to state whether he offered his services for this purpose and to whom and why they were declined

Society's Freeboard (if assigned) as painted on Ship and now verified

Was a damage report made by anyone else? If so, by whom?

REPAIRS, OR EXAMINATION AS PER RULE, FOR ~~Overhauling~~ ~~Ann. L.L.~~ ~~Equipment~~

The vessel places on the Marine Rm., the bottom rudder cleaned, & painted & resat.

Found:- The bottom in good condition with the exception of indented shell plating P.S. The rudder

down the bearing balls of the rudder have been cleaned, & the rudder plating aft. starts

side, indented in way of after peeing port. All peeing ports seized.

Done:- The indented shell plating P.S. not dealt with at this time. The rudder lifted with rudder head

bearing balls renewed. The rudder plating aft. starts side, cropped. Port renewed & butt welded where

cropped & all peeing ports made available.

Equipment:- The spare lower anchor now on board verified & found satisfactory. A total length of

150 fathoms of 1 1/2" steel line chain cable has been supplied the vessel & all equipment is now in order.

S. R. 1st:- Indented plating (P.S.) 30 fms of cable to supply lower anchor to verify. Done:- Indented plating not dealt

with. Lower anchor verified. A total of 150 fms of cable fitted.

SUMMARY OF DAMAGE REPAIRS:-

Renewed ... Shell Plates. Frames. R. Frames. Floors and Bracket Floors. Beams. Inner Bottom Plates. Dk. Plates. Other Items.

Removed and Faired or Repaired ...

Faired or Repaired in place ...

PRESENT CONDITION OF THE

Decks ... Bulkheads ... Engine Room Skylights ... Copper, or Y.M. (State if on Felt.)

Caulking of Decks ... Ceiling ... Coal Bunkers, Openings, Covers, &c. ... When fitted, Month ... Year ...

Seamings ... Cement or Asphalt ... Oil Bunkers ... Boats ...

Beams & Fastenings ... Rudder ... Scuppers ... Masts, Yards, &c. ...

Outside Plating ... Steering gear and its connections ... Cargo Hatchways ... Condition, how ascertained (State if wedges removed)

" " in way of sidelights ... Windlass ... Hatches ... Equipment letter

Frames ... Have pumps been examined and found efficient? ... Planking ... Anchors, No. of

Reverse Frames ... Have Sluice Valves been examined and found efficient? ... Caulking ... Cables (State if now ranged)

Longitudinals ... Have Watertight Doors been examined and found efficient? ... Treanils ... " length ... mean diam.

Transverses ... Have Ventilators and their Coverings been examined and found efficient? ... Transoms, Pointers & Crutches ... " Rule length ... size

Floors ... Air and Sounding Pipes ... Timbers of Frame at openings ... Chain Locker

Keelsons ... Doubling Plates under Sounding Pipes ... " at other places ... Hawser & Warps

Stringers ... Have the Tanks been examined internally? ... Stringers, Clamps & Shelves ... Standing and Running Rigging

Inner Bottom Plating ... Have the Tanks been tested? ... Salting (State if examined.) ... Sails

General Observations, Opinion as to Class, Recommendation, &c.:-

State clearly whether any and, if so, what alteration is suggested to be made in the existing classification and notification of the vessel in the Register Book consequent upon this survey, thus, for example:- "to remain as classed in the Register Book without fresh record of Survey," "to remain as classed and to have record of survey, 1,38," or "to remain as classed and to have record of survey, 1,38, and the notations of ss No. 1-38."

Recommend that this vessel be continued as now classed & have a fresh record of Survey 7-41

Survey Fee (per Section 29) ... Fees applied for, July 3rd 1941

Special Damage or Repair Fee (if any) ... Received by me, 19

Travelling Expenses (if chargeable) ...

Second Surveyor's Fee (if any) ...

Committee's Minute

Character Assigned

56.41

TUE. 28 OCT 1941

100 ft

In Venezuelan Coastwise Service

Cargo battens not fitted + dmb. (M) 7-41

Subject

Withdraw Class

Lloyd's Register

Foundation

005524-005536-0073

Friday 3rd July. 1942

Cassip Communities' decision

confirmed

H.N.

ANCHORS.

* When a bower anchor is supplied it must be clearly stated whether it is a 1st, 2nd, or 3rd bower.

[illegible]