

COPY



Hong Kong

30th, August 1940.

This is to Certify that

T. S. MORRISON

the undersigned Surveyor to this
Society did at the request of

Messrs Taikoo Dockyard & Engineering Co. of Hong Kong Ltd. survey
the S.S. "PAZ" of Manila, 4260 Gross Tons, No. 31406 in the Register
Book, on the 26th. August 1940 and subsequently whilst the vessel
in dry dock at Taikoo Dockyard, for the purpose of ascertaining the
nature and extent of damage stated to have been caused by the vessel
striking the quay wall when being drydocked at Taikoo Dockyard on
24th. August 1940.

For further particulars see Log Books.


The undersigned upon examination.

FOUND

Shell plate G-14 Starboard
side indented.
Five frames & 6 margin brackets
in way buckled.
Shell plates E-13 & 14 slightly
indented.
L-6 (bridge side) indented.
One beam knee buckled.
One bridge aft bulkhead plate
buckled.
Two angle frames bent.

RECOMMENDED

To be removed, faired and
replaced.
To be removed, faired and
replaced.
To be faired in place.
To be part faired in place
& cropped & part renewed.
To be renewed.
To be cropped & part renewed.
To be cropped & part renewed.

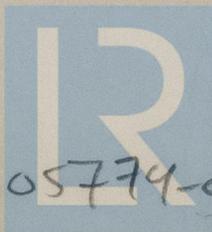

© 2021

Lloyd's Register
Foundation

005774-005790-00432

(2)

S. S. "PAZ"

All removals necessary to carry out above repairs
to be replaced in good condition and new and disturbed work
to be recast.

The above recommendations have now been satisfactorily
carried out.

W. L. Morrison

Surveyor to Lloyd's Register.



© 2021

Lloyd's Register
Foundation

005774-005790-0043

2/3