

Received by Chief Ship Surveyor.....

Received from Chief Ship Surveyor.....

VESSEL'S NAME "GEORGIOS POTAMIANOS" REPORT Cal. No. 12066

The remarks of the Chief Ship Surveyor are desired on this case for the consideration of the Classing Committee.

("The endorsement to contain a succinct summary of any repairs that have been required and to show the cause or causes of such repairs, and also to bring out clearly any exceptional features in connection with the case, so that the Classing Committee may have all the salient points presented in the endorsement."—Extract from Sub-Committee's Report, 24/5/92.)

A General Examination for maintenance of class became due 5.44.

Action has been deferred pending receipt of the Calcutta Surveyor's report.

The class is subject to indented plating<sup>permanent repairs</sup> at stokehold bulkhead and structure in way (p.s.)<sup>etc</sup> and to permanent repairs to Upper deck sheerstrake<sup>etc</sup> just forward of the Bridge, broken stringer angle, holed stringer plate and twisted frame at the first opportunity and to special examination of the shell plating (worn riveting) at the next dry docking and to permanent repairs to corroded stiffeners, to coamings of Nos. 1 & 2 and cross bunker hatchways, E.R. skylight etc., trunks of ventilators to galley and E.R. and sternframe gudgeon bushes at the first available opportunity.

The CALCUTTA Surveyor reports (7.44) this vessel afloat, a General Examination carried out and renewals or repairs effected to tank top plating, floors etc. in aft peak and to fiddley top plating. The E.R. skylight, as above, has been dealt with.

The defective beam sockets in all hatchways have been renewed but those at Nos. 2, 3 & 4 only bolted in place. The Surveyor recommends these be riveted at earliest opportunity. (1)

The floors and intercostals in D.B. tank below the boilers found thin. The Surveyor recommends these be dealt with at the earliest opportunity. (2)

IT IS SUBMITTED the vessel is worthy to remain as classed subject as now recommended (1) & (2) and as above, and to notation of "Examined 7.44" valid for 12 months assigned, when (1) & (2) have been dealt with.

Ad now, subject.

"Examined 7.44" when repairs effected.


13.10.44

Insert in SRC

Remission 1+2:

Delete from SRC

Repair to E.R. skylight, hatchways, sternframe

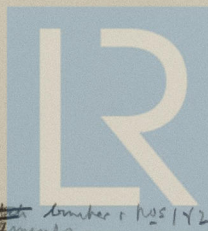

© 2021

Lloyd's Register Foundation

005779-005790-009



H  
J  
E  
I  
M  
N  
O  
P  
Fla  
Bil  
She  
Str  
RTEI  
ES  
SID  
PL  
actur  
e of  
ide P  
el bee  
extend  
B.F.R  
STS...  
Yards  
Materia  
nt No  
An  
1st Bo  
2nd  
3rd  
Collecti  
Stream  
Kedge  
Len  
size  
Leng  
Fath  
hain  
Number  
is

Delete all items

and

Insert

6

A



© 2021

Lloyd's Register  
Foundation

Wireless Steam (Yard & Mergies)

Capstan

Ship's ...

Stockless state Mechanic Tools