

C O P Y

LLOYD'S REGISTER OF SHIPPING

PORT SEATTLE WASHINGTON.

APRIL 5th. 1933.

THIS IS TO CERTIFY that

C. HASTIE.

the undersigned Surveyor to this Society did at the request of
Mr. S. Aitken, Owners representative Survey the Single Screw Sr.

"COMMERCIAL TRAVELER"

4752 tons Gross Register of New York, for the purpose of
ascertaining the nature and extent of damage stated to have
been sustained through vessel having grounded on the middle of
Pea Patch Shoal at Edge of Bulkhead Channel Shoal 350 feet from
nun bouy No. 3 6-P.M. Dec. 24th, 1933, and subsequently striking
spit extending off Southwest end of Quemos Island 12-45 A. M.
March 2nd.

For full and further particulars refer Log Books.

On the 13th day of March and subsequent dates visited
the vessel whilst lying on the Todd Dry Docks Inc., made exami-
nation of machinery found and recommended as follows:-

FOUND

RECOMMENDED

PROPELLER

One blade of propeller
broken off at root.

A new propeller of equal
weight, size and material
to be supplied. fitted.

PROPELLER SHAFT

Propeller shaft down and

Shaft to be drawn and examined



© 2020

Lloyd's Register
Foundation

007714-007721-0343 1/2

ss. "COMMERCIAL TRAVELER"

FOUND

Lignum Vitae bearings
slack.

RECOMMENDED

together with stern bush,
tube etc., New Lignum Vitae
fitted in lower portion of
bush.

Supplementary

Propeller shaft and
lowers found fractured.

A new C. H. Steel propeller
shaft with full gunmetal
liners to be supplied and
fitted.

To be opened up and adjusted.

MAIN ENGINES AND AUXILIARIES

CRANK AND LINE SHAFTING:-

Crank shaft down at No. 1
bearing 5/32" and metal
of all main bearings wiped.

All shaft couplings to be
broken to test for alinement.
The crank shaft to be lifted
and all main bearings remetal-
led. Tunnel shaft bearings
cleaned and examined and all
shafting lined up when vessel
put afloat.

MAIN BEARING SPANNER

Broken.

To be replaced by new.

L.P. BOTTOM END BRASSES.

Metal of same destroyed
(spare brasses put in place)

Same to be removed and remetal-
led and crank pin dressed.

H.P. PISTON RING

H.P. Piston ring broken.

Same to be replaced by new of
equal dimensions and properly
fitted.

STEERING ENGINE

Main gear wheel of steam
steering engine broken and
thrust washers of worm
shaft destroyed.

The gear wheel and thrust
washers to be removed and
replaced by new.
Engine overhauled and tested
out.

Supplementary

Worm or Engine shaft found
fractured.

Shaft to be taken out and
replaced by new of equal size
and quality.

DOCK TRIAL

Upon completion of repairs
the main engine and auxiliar-
ies to be given a four hour
dock trial for verification.