

SHIP'S NAME "E R A" REPORT Syd. No. 27418

Outstanding Conditions of Class: Subject to bulkhead plating between Nos.1 & 2 holds (wasted) being examined and dealt with as necessary, and to permanent repairs to deck plating between beams Nos. 62/63 portside of E.R. also tank side bracket connections in engine space (p & s) being examined and permanently repaired by next Special Survey, to permanent repairs to 3rd pillar D.B. tank top connection (from F.P, bulkhead in No.1 hold) by next drydocking, and to permanent repairs to No.2 D.B. tank top plating in No.2 hold on ship's arrival Sydney from present voyage - tanks not to be pressed up meantime until repaired.

Endorsement of Class (B) (As before or None)

Surveys due:

SPECIAL SURVEY (C) due 5,54 - commenced NSW 4,54.

Signature of Present Survey: (Afloat and in drydock)

Advancement of Special Survey.

Special Features:

See last paragraph below.

Interim Certificate in order (Yes-No-None)

Items Outstanding (if any for S.S. or A.S.)

FOR PORTION OF SURVEY HELD:- See NSW Rpt.No.6371 & Syd.Rpt.No. 27418.

S. to be completed by:

Recommendation: SUBJECT as above, with Endorsement (B), but further ACTION be DEFERRED for completion of Special Survey.

As Now. Subject.

ENDORSEMENT OF CLASS (B). Indents in bottom plating (p.s.a.). Indented shell plate, etc. at break of poop (p.s.). Shell plating in 2nd below sheer (s.s.) indented.

S.S. PART HELD.

In a letter dated 3.8.54 the Sydney Surveyors advise that on account of the extensive repairs required the Owners have decided not to complete the Special Survey, and they therefore recommend that the classes expunged, which is also submitted for consideration.

Lloyd's Register Foundation 2021 068288-0082 95-0430