

K. DANE

PART Special Survey No 1.

Now done

Forepeak examined, bulkhead found somewhat wasted, a welded plate patch has been fitted over a weak portion on top port side, this is considered an efficient temporary repair. Owners Supt states that the bulkhead will be dealt with before completion of survey.

Engine and boiler spaces (except tunnel space) examined, lower portion of E.R. space to scale and recoat. Several minor items require attention (i.e. stringer angle legs to renew, one pump seating bracket to have strap fitted)

Masts and rigging examined, repairs effected as per attached report.

To complete the survey the aft peak, forecastle, tunnel space, chain locker, fishroom, cross and wing bunkers, ceiling, decks, hatchways, windlass, general equipment, steering gear, deck pumps, anchors and cables, cement in bottom, and the W.T. don^{ventilators} remain to be examined. Mark ~~edges~~ of any + sounding pipes
 Permanent repairs to E + B Casings required

g.p.

See letter
29.11.39
15.11.40