

COPY.

s.s. "SAN PIETRO".

Extract from Naples report N°2277, dated 29.6.23.

Vessel placed in drydock, bottom and rudder cleaned examined and coated. Found in N°5 strake below sheer starboard side N°5 plate indented and upper edge of plate below set in. Now done as a temporary repair:- The rivets in indent renewed, landing edge of plate faulted and some same rivets dealt with. As the above indent does not effect the vessel's seaworthiness it was arranged to deal with them at a more convenient opportunity.

Baltimore 3502, dated 18.8.23.

Repairs recommended but not made? N°1 hold. 8 indented in tank top plating to be faired, hold ladder to be faired, limber boards to be caulked and grain strips fitted as necessary. N°2 hold fourteen indents to be faired, limber boards to be caulked and grain strips fitted as necessary. N°3 hold three indents starboard side and one port side tank top to be faired, limber boards to be caulked and grain strips fitted. N°4 hold four indents port side and two on starboard side tank top to be faired, limber boards to caulk and grain strips to fit. The d.b. tanks under all holds to be tested and proven tight in way of repairs.



© 2020

Lloyd's Register
Foundation