

TUC "RESTAURADOR"

Sea valves generally overhauled.

All main and auxiliary pumps overhauled and minor details renewed.

General service pump- cylinder bored out and piston renewed.

Main impeller machined and sealing rings renewed.

Main steam piping- 5 lengths of solid drawn copper steam piping removed, annealed tested to 450 lbs. square inch and replaced.

Electric light installation

Generator overhauled, various circuits and apparatus renewed or repairs as necessary, satisfactorily tested upon completion.

NOTE:- Main boiler

There is some scattered pitting at the internal surfaces of the bottom shell plating but is efficient. The pitting has been thoroughly cleaned out and a coating of apexior applied.

W.R.



© 2020

Lloyd's Register
Foundation

0255 2/2