

Rpt. 8

Port HONG KONG.

No. 17243.

Date of writing Report 5-9-62.

When handed in at Local Office 5-9-62.

Received London

Survey held at Hong Kong.

No. of Visits 2

First Date 2-9-19 62.

Last Date 5-9-19 62.

REPORT OF SHIP SURVEYS AND REPAIRS

(The Surveyor's attention is drawn to the relevant requirements of Chapters B & C of the Rules.)

No. in R.B.

62635

on the Iron or Steel M.S.

"GEORGIA MARU"

Tons gross 7662

Built at Yokohama.

By Whom Mitsubishi Nippon Hvy. Ind.

Year 1956 Month 12

Owners Mitsubishi Kaiun K.K.

Owners' address
(If not already in R.B.)

Managers

Port of Registry Tokyo.

Surveyed Afloat or in Drydock Afloat.

Name of Dock

Date of last examn. in Drydock

N.B.—Any alterations in existing particulars in the Register Book should be reported and underlined.

Last Report: No. 9686

Port KOB

To be filled in at Head Office.

Particulars of Classification (which must be inserted precisely as in Register Book and Supplement)

Surveys must be reported in the terms of the Rules. The nature and extent of Examinations and Repairs (if any) must be stated in detail, the parts examined and their condition being clearly indicated. For Annual, Special or other Condition Surveys the Summary of Examination and Condition on the back of the Report is to be carefully completed and amplified if necessary in the body of the Report. Outstanding items to complete the Survey should be summarised at the end of the Report. The reasons for Repairs must be stated. Repairs on account of Damage (the alleged cause of which must be stated) should be separated from Repairs due to other causes, and, besides being detailed in the body of the Report, should be summarised in the form below. When, at a Special Survey, the Shell and Deck Plating is drilled the results must be reported on Report 8(Dr). Whenever Anchors or Chain Cables are replaced or retested the necessary particulars are to be given on Report 8(Eq) which is to be attached to this Report.

Give dates and references to any letters relating to this Report

SHIP'S CLASS		Machinery	
Date of Special and of Drydocking Surveys, etc.			
+100A1	11.61	+IMC CS	2.61
SS	2.61	ABS	11.61
		TS CL	5.60
		SPS	2.61

In damage cases where the Surveyor has not made a special damage report he should state whether he offered

his services for this purpose and to whom and why they were declined Damage report

Freeboard as marked on ship and now verified -- ft -- ins

attached.

Was a damage report made by anyone else? If so, by whom? --

EXAMINATION AND REPAIRS AS PER RULE FOR DAMAGE

Attended on board at Lloyd's Agents request regarding stated damage caused by the vessel being struck by S.S. "NINA", 1463 tons gross, of Panama, during typhoon "Wanda" on the 1st September, 1962, whilst lying at anchor in Hong Kong Harbour.

Now Done :

Starboard side forecastle bulwark plating and top rail set in heavily, cropped and part renewed.

Starboard side forecastle handrails and stanchions set in, part cropped, renewed and part faired.

Starboard side forecastle sheer set in and torn, cropped and part renewed.

Starboard side forecastle fashion plate and top angle set over and torn, released and faired.

Starboard side forecastle stringer plate set down, cropped and part renewed.

Bridge deck starboard side bulwark and top angle set in and torn, released, faired and part renewed.

Bridge deck fashion plate torn and buckled, removed, faired and refitted.

Bridge deck one deck beam in way set down, removed, faired and refitted.

CONTINUATION OVER/OR SHEET 2

SUMMARY OF DAMAGE REPAIRS	Shell Plates	Frames	R. Frames	Floors and Bracket Floors	Inner Bottom Plates	Deck Plates	Beams	Other Items
Renewed	1	--	--	--	--	2	--	Bulwark plating, handrails, & curtain plates, bulwark plating.
Removed and Faired or Repaired	--	--	--	--	--	--	1	
Faired or Repaired in place	--	--	--	--	--	--	--	

Has a Survey also been held on machinery of the Ship? No.

Is Classification Certificate required? If so, to be sent to --

If so, is the Report sent now, or when will it be sent? --

Has Interim Certificate been issued? Yes.

GENERAL OBSERVATIONS, OPINION AND RECOMMENDATION AS TO CLASS

State clearly what alteration, if any, is suggested to be made in the existing Classification or Survey or other records of the Ship in the Register Book consequent upon this survey; for example:—"to remain as Classed in the Register Book without fresh record of Docking"; "to remain as Classed and to have record of drydocking 1.55"; or "to remain as Classed and to have record of drydocking 1.55, and the notation of S.S. . . . 1.55".

This ship as now surveyed is eligible, in my opinion, to remain as now classed in the Register Book, without fresh record of Survey.

D.C. Wood.

Surveyor to Lloyd's Register of Shipping

Date of Committee

THURSDAY - 4 OCT 1962

Minute

DS 8. 62

Noted
for
Header

© 2020

Lloyd's Register
Foundation

009796-009806-0056

10/10/62

TABLE 1

PARTS OF THE SHIP AS INDICATED BELOW HAVE BEEN EXAMINED FOR SURVEY

Items	Now Examined YES NO or NONE	Tanks	Now Examined Internally	Now Tested
Shell plating, sternframe and rudder cleaned, examined and recoated in drydock		F.P. Tank		
Rudder lifted		A.P. "		
Weather Decks, Superstructures and Casings		D.B. Tanks (indicate Oil Fuel and Cofferdams		
Hatchways, Covers, closing and securing appliances				
Ventilator coamings, skylights, companionways and closing appliances		Fresh Water Tanks		
Holds		Deep Tanks		
'Tween Decks		Oil Fuel Bunkers and Settling Tanks		
Fore Peak Spaces		Side Tanks		
After " "		Wing Tanks		
Engine Space		Other Tanks		
Boiler "		Cargo Tanks (Tankers)		
Under Engines and Boilers				
Tunnel and Well		Cofferdams		
Coal Bunkers		Pump Rooms		
Chain Locker				
Other Spaces				
		Have Tanks now Examined been Cleaned as Necessary?		
		Have Strums in Cargo Tanks (of Tankers) been removed?		
		Have Tanks been Retested as necessary after completion of any Repairs?		

Have the spaces now surveyed been cleared and cleaned as necessary?

Have the close ceiling and cargo battens, linings, pipe casings, etc., been removed and replaced as required by the Rules?

Have the bilges been cleaned out and examined? Has cement in bottom been examined?

Has steelwork had rust removed and afterwards been recoated as necessary?

Were inspection plugs or any insulation removed in insulated spaces for examination of steelwork?

Has a Load Line Survey been held? If so, state which

Have the shell and deck plating been drilled as per Rule? If so, Report 8(Dr) to be attached

Have any alterations to the approved scantlings and arrangements now been effected? If so, report details in body of Report.

NOTE:—Indicate which compartments and/or tanks have been examined or tested by giving the identification numbers and inserting the word "Yes", e.g. Holds: Nos. 1, 2 & 3—Yes; or All—Yes.

TABLE 2

The present condition of the following parts in so far as examined is to be reported:—

Shell plating	Ceiling and Cargo Battens	Sluice Valves examined and found
" " in way of side scuttles	Cement or Asphalt	Air and Sounding Pipes
Rudder and Sternframe	Cargo and other Hatchways	Doubling Plates under Sounding Pipes
Decks	Hatches and closing appliances	Masts and Rigging examined and found
Superstructures and their closing appliances	Ventilators, their coamings and closing appliances	Condition, how ascertained (State if wedges removed)
Coamings and Casings	Companionways and Skylights	Chain Locker
Beams and Fastenings	Shell Openings	EQUIPMENT
Frames	Ash Shoots	Equipment Letter
Reverse Frames	Overboard Discharges and Scuppers	Anchors, No. of Condition
Longitudinals	Freeing ports	Cables (State if now ranged and examined)
Transverses	Steering Gear (Main and Auxiliary)	" length mean diam. (on board)
Floors	examined and found	" Rule Length Size
Keelsons	Windlass examined and found	Hawsers and Warps
Stringers	Pumps " " "	State if any Anchors or Chain Cable have
Inner Bottom Plating	W.T. Doors " " "	now been supplied or retested, if so
Bulkheads and Tunnel		complete Report 8(Eq) and attach.

Have conditions (A) or endorsements (B) of Class (if any) been dealt with? See Below

REMARKS, REPAIRS, Etc. (Contd.)

Now Done : (Contr.)

Bridge deck curtain plate torn and buckled, cropped and part renewed.

Boat deck starboard aft deck plate together with curtain plate heavily set up, cropped and renewed.

Survey Fee

Special Damage or Repair Fee (if any) \$130.00

1/2 S.F. 62.50

Travelling Expenses (if chargeable) 20.00

Second Surveyor's Fee (if any)

Date when A/c. Rendered 5-9-62