

## REPORT of SURVEY for REPAIRS, &amp;c.

Date of writing Report 30 July 1917 When handed in at Local Office 101

Port of Stockholm

No. in  
Reg. Book.

Survey held at Stockholm.

Date, First Survey 26th June Last Survey 30th July 1917  
(No. of Visits 4)

552 on the Wood, Iron or Steel S.S. Emil R. Boman.

Master C.H. Jönsson. 07-15.

TONNAGE:-

Built at Middlesbro'

By whom W. Harkess &amp; Son.

When 1901

MONTH 11

GROSS 1223

Owners Motala Rederi Aktieb./C.A. Arvidson Mgr/. Port belonging to Motala.

UNDER DK. 865

Owners' Address

NET 711

(if not already recorded in Appendix to Register Book).

Surveyed Afloat or in Dry Dock? on the Name of Dock Finnboda Pontoons Destined Voyage Neder Kalix.

WB=CellDBorDBa feet; uE&B feet; f feet; }  
total capacity tons. FPT tons; APT tons; MT feet tons. }Particulars of Classification (which must be inserted  
precisely as in Register Book & Supplements).

N.B.—All alterations in the existing records should be underlined.

If the Vessel has Water Ballast Tanks, state whether the manhole covers have been removed, and the insides  
of the tanks examined. Also state the amount of deterioration (if any) found in the thicknesses of the floors, framing,  
girders, and of the inner bottom plating, especially in the boiler space.

Last Report, No. 69120 Port Gpn. hwc

CHARACTER.  
\* for Special Survey.  
Date of last Survey and of  
Periodical Surveys.

\*100A1

10.15 8.16

S.S. Bly. No. 3-7.14

Machinery and Boiler  
Surveys  
(including date of N.B., if any).

\*LMC 6.13

M.B.S. 7.16

D.B.S. 2.16

Tailsh. seen 10.15

(Periodical Surveys, when held, must be reported in detail and serially in the terms of the Rules. State clearly the  
cause of Repairs, if any, and, in detail, the nature and extent of Examinations and subsequent repairs. Repairs  
on account of Damage (the cause of which must be stated) should be separated from Repairs due to other causes;  
and besides being detailed in the body of the report, should be summarised in the form shown below. Whenever the  
replacement of Anchors or Chains is reported, the particulars should be clearly stated in the space provided on  
the back of this form. State also the dates and initials of any letters respecting this case. H.8.6.17.Society's Freeboard (if assigned) as  
painted on Ship and now verified } ft. ins.

CARGO BATTENS NOT FITTED.

In damage cases where the Surveyor has not made a special damage report he is required to state whether he offered his services for this purpose and to whom and why  
they were declined? Was a damage report made by anyone else? If so, by whom?

REPAIRS, OR EXAMINATION AS PER RULE, FOR Condition and damage repair.

This vessel was stated to have sustained damage to the port side bulwark, in way of hatch  
No.1., through heavy weather in the North Sea, on the 18th and 19th November 1916, when she was  
proceeding on a voyage from Salsåker to London with cargo of wood./For further particulars see  
log book/.

On examination, vessel on the Finnboda Pontoons, J found the following damage and recom-  
mended it to be repaired in the following manner, which has now been done.

The foremost bulwark plate, on port side, found slightly bent, to be faired in place.

The plate next to the foremost, found bent, to be removed, faired and refitted.

The foremost length of the bulwark top angle, found bent, to be removed, faired and refitted.

Condition. This vessel has been taken on the Finnboda Pontoons, where the bottom, rudder

SUMMARY OF DAMAGE REPAIRS:—	Plates.	Frames.	R. Frames.	Floors.	Beams.	Str. Plates.	Dk. Plates.	Other Items:—
Renewed .....								
Removed and Faired or Repaired .....	/							
Faired or Repaired in place .....	/							

PRESENT CONDITION OF THE	Stringers	Inner Bottom Plating	State if Tanks have been examined inside	State if Tanks now tested	Bulkheads	Ceiling	Cement or Asphalt (State which.)	Rudder	Steering gear and its connections	Windlass	Have Pumps now been examined and found efficient?	Have Sluice Valves now been examined and found efficient?	Have Watertight Doors now been examined and found efficient?	Dbing. Plates under Sounding Pipes	Engine Room Skylights	Coal Bunkers, Open'gs, Lids, &c.	Scuppers	Cargo Hatchways	Hatches	Planking of Wood Vessels.	Caulking ditto	Treenails ditto	Breasthooks & Stemson ditto	Transoms, Pointers, & Crutches ditto	Timbers of Frame at openings ditto	Ditto ditto at other places ditto	Stringers, Clamps & Shells ditto	Salting (State if examined.)	Copper, or Y.M. of Wood Vessels (State if on Felt.) When put on, Month	Boats	Masts, Yards, &c.	Condition, how ascertained	Sails	Equipment letter	Anchors, No. of	Cables (State if now ranged)	Hawser & Warps	Standing & Running Rigging
Decks	Good		Not ex.	No	Where seen good	"	Not ex.	Good	"	"	Yes, but not tried	None fitted	Yes	Not ex.	Good	"	"	"	"	"	"	"	"	"	"	"	"	"	Good	2 life 1 other boat	Good	From deck	Not ex.	n	3B. 1Str. 1K. good	Part	Good	"
Caulking of Decks	"			No		"				"																												
Waterways	"					"				"																												
Coamings	"					"				"																												
Beams & Fastenings	Where seen good		Not ex.			"				"																												
Outside Plating	Good					"				"																												
Caulking of ditto	"					"				"																												
Rivets	"					"				"																												
Breasthooks & Crutches	Not ex.					"				"																												
Transoms	"					"				"																												
Frames	Where seen good					"				"																												
Reverse Frames	"					"				"																												
Floors	Not ex.					"				"																												
Keelsons	"					"				"																												

General Observations, Opinion as to Class, Recommendation, &amp;c.:— This ship now appears to

State clearly whether any and, if so, what alteration is suggested to be made in the existing classification and notification of the vessel in the Register Book consequent upon  
this survey, thus, for example:—"to remain as now classed in the Register Book without fresh record of Survey," "to remain as classed and to have record of  
survey, 1,15," or "to remain as classed and to have record of survey, 1,15, and the notations of ss No. 1-15 and ptND15, &c."

be in a good and efficient condition and is eligible in my opinion to remain as classed with  
fresh record of Bottom Survey Skm. 7.17.

Survey Fee (per Section 28) .....	£	4	:	4	:	0	Fees applied for,
Special Damage or Repair Fee (if any) .....	£	4	:	14	:	0	30.7. 1917
Travelling Expenses (if chargeable) .....	£		:		:		Received by me,
Second Surveyor's Fee (if any) .....	£		:		:		19
Total .....	£	8	:	18	:	0	

Committee's Minute FRI. 24. AUG. 1917

Character Assigned

Surveyor to Lloyd's Register of Shipping.

Assisted by Mr. V. Schell.

Lloyd's Register  
Foundation

009912-009414-0092



Repairs wear and tear, now carried out.

A number of rudder rivets, found pitted and loose, have been renewed.

About 20 wooden hatches, found worn, have been renewed or repaired.

under my supervision and to my satisfaction. The workmanship is good.

Atkinson

## ANCHORS.

[illegible]

\* When a bower anchor is supplied it must be clearly stated whether it is a 1st, 2nd, or 3rd bower.

## CHAIN CABLES.

[illegible]

**A.B.**—If this Report is copied by Copying Press, especial care must be taken that the copying paper is not so much dampened as to spread the ink, or to cause it to show through to the other side.