

S.S. "DESLOCK"

Safety valves adjusted under steam as stated above on the 17th Dec. 1940.

Special reasons List:-

Propeller was not dealt with at this time, and found in efficient condition.

Repairs due to wear & tear:-

H.P. slide valve casing skimmed up and piston valve rings renewed.
H.P. crosshead pin brasses remetaled.
Bilge, sanitary and feed pump plungers skimmed up and new neck & gland bushes fitted.
One horse shoe of thrust bearing remetaled.
14 boiler tubes renewed.

Other repairs of a minor nature effected.

T.K.

*N.A. No 1 due 2.40 } has held
B.S. due 9.40 }
Minor repairs effected
Propeller examined & still efficient*

*It is submitted that
this vessel is eligible for
THE RECORD.*

+ has. 12.40

How

6.11.41

*Suggest to propeller
being renewed at
first opportunity*



© 2021

Lloyd's Register
Foundation