

Ship's name SS. AKAMAS

① Fokohama # 5277, 9/5/64
Cebu L.A. 28, 27/5/64 & later.
Port Honolulu No. 102

Class is subject to ① M.E. redplate (Metalock 1/63) Last survey date 28/3/64.

- being examined by 11/64,
② Propeller, underwater fastenings & sea-valves being
specially examined at next D.D.,
③ Starboard boiler being re-examined and wasted cc. stays and
air-heater tubes being repaired by completion of MBS.

MBS. (due 9/63) commenced 11/63 & not advanced, repairs.
at Honolulu after initial hydraulic test on all 3 boilers.
About 60 tubes plugged & 60 ~~tubes~~ air heater tubes ~~plugged~~
blanked off in all 3 boilers. Air-heater tube plates (buckled) repaired.
Crack in Centre furnace, centre boiler repaired by E.W. All spt. headers
and elements removed & U bends fitted at inlets & outlets. Cause of
damage in opinion of Surveyor - salt feed.
at Fokohama. About 190 tubes plugged and 48 air-heater tubes
plugged in Port and centre boilers. Nothing done re starboard boiler.
at Cebu Remaining (starboard) boiler re-examined - no repair
reported.

The Fokohama Surveyor recommends that the defective
tubes (plugged) in the Centre and Port boilers be renewed at
the earliest opportunity and by 9/64 (4 mos. limit). It is
therefore recommended that the wasted combustion chamber
stays in the starboard boiler and the defective smoke and
stay tubes and air-heater tubes (plugged and then) ~~be renewed~~ in all 3
boilers be renewed
(at the earliest opportunity and by 9/64 (4 mos. limit)).

It is submitted that the
vessel WILL BE eligible
for the record MBS 11/63
when the survey has been
completed,

subject as above re M.E. redplate, propeller & sea-valves,
as was amended & recommended re all 3 boilers.

The Owners should be asked that arrangements be made for the repairs
to the boiler being carried out at an early date. (Continued) 6/64

010219-010228-02811/2

(2)

0281 2 1/2

Ship's name ^{w/v} "AKAMAS"

Port

No.

Class is subject to

Last survey date

To complete the MBS:—

The subject item against the 3 boilers to be

dealt with.
NOTE. TSC. (due 6/64)

NOTE for RB.

Delete "Spt." as not all removed.

SRL. appendix to note.

Spt. elements and headers removed, 3/64.

The Lloyd's Agents, Cebu City, should be

asked to furnish the qualifications of Mr. R.M. Robles,

the surveyor appointed by them to survey the starboard boiler of S.S. "AKAMAS" in May last. They should be informed

that wasted combustion chamber stays and ^{boiler} stay tubes and air-sealer tubes (plugged and then) in the starboard remained to be dealt with as found necessary and be asked to state whether any or all these repairs were carried out and examined by their appointed surveyor. Details of any repairs should be stated by the surveyor.

No repairs except some
tube re-attached
Lth. J. 10/10/64.
a. 7.
9/12/64.