

"NAIRA", "NUKAHA" & "NAIKO"

No. 675

Propeller damage

Inform Bureau Leslie & Graham of the propeller damages detailed in the endorsement of 11-2-59 attached to "NAIKO" report, with the following additional information relating to the "NAIRA"

- 3-59 Damaged propeller replaced by the spare bronze propeller
- 8-59 Ship surveyed afloat. One blade tip missing, 2 others chipped. Cause not stated. No repairs
- 10-59 Used spare propeller fitted. The tips of 3 blades of this propeller had previously been repaired over a length of 2"
- 3-60 10" of one blade broken off, tips of 2 others slightly bent. Cause not stated. Ship surveyed afloat. No repairs. New propeller on order.
- 5-60 A new section welded on to the stove damaged blade
- 6-60 A re-conditioned bronze propeller fitted.
- 8-60 8" of one blade broken off. Cause not stated. A re-conditioned bronze propeller fitted.
- 9-60 12" of one blade broken off. Cause not stated. Cast iron spare propeller fitted.
- 10-60 24" broken off each of 2 blades. Stated damaged in service. A re-conditioned bronze propeller fitted
- 12-60 Half of one blade broken off. Stated to have occurred at 7 a.m. on 9-12-60, cause unknown. A used bronze propeller fitted
- 2-62 8 1/2" broken off one blade, 2 others slightly turned over at leading edges 3" from tip. Cause unknown. A repaired bronze propeller fitted.

"NUKAHA" If no reports later than those dealt with in the endorsement of 11-2-59 have been received, this should be stated together with the date of withdrawal of class, if any.

List. 13.8.62

010355-010361-0268