

COPY

W. Yickell.

Lloyd's Register of Shipping,

71, Fenchurch Street, E.C.3.

17th September, 1947.

Dear Sirs,

S.S. "BENVRAKIE" ex "SAMAPPRIC"
Classification.
Electrical Installation.

I have to inform you that the above vessel has been under survey at this port for classification and that a Report 13 is in course of preparation. Time did not allow of the survey being completed and the Owners Superintendent states that this will be done at your port where the vessel is due to arrive about the 20th instant.

The following items remain to be dealt with:-

- (a) An alternative supply to the Navigation Lights is to be provided.
- (b) The following circuits have a "low" insulation test and are to be brought up to Rule requirements.

Main Switchboard.

- L.1. Engine Room.
- L.3. Midship Accommodation.
- L.4. " "
- L.7. Boat Deck. "
- L.9. Bridge Deck.

- (c) Nos. 1 and 3 generator voltmeters to be recalibrated to facilitate parallel operation of generators.
- (d) No. 3 generator field regulator to be overhauled - suspected open circuit or faulty contact at approximately "working" voltage.
- (e) Distribution Boards to be overhauled, special attention being given to fuse spring contacts

010478 - 010483 - 0119

Lloyd's Register
Foundation

COPY

Lloyd's Register of Shipping

where heating is taking place.

(f) A set of correctly wired fuses to be fitted throughout vessel and a spare set to be provided.

(g) Rewire.

Binnacle Light feed top bridge.
Deck lights port side of poop.

I should be glad if you would kindly give this matter the necessary attention in due course.

Yours faithfully,

Secretary.

The Surveyors,
LEITH.



© 2021

Lloyd's Register
Foundation