

INSPECTION REPORT

T.2 Tanker "ZEITOUN"

An inspection of the CO₂ fire extinguishing equipment was carried out on board the above vessel and all cylinders were disconnected and weighed and two cylinders were found to be empty, as shown on the enclosed sheet. These cylinders were sent ashore for refilling and will be reinstalled before the vessel sails.

All pull handles were examined and tested for free operation. One pull wire would not operate and the fault was traced to a junction box, where the line was cleared and greased and the box reassembled. The pull box was tested and left in good order.

The two pull boxes for the Aft Pump Room were found to be loose. New holes were drilled and the pull boxes made fast with new bolts.

All piping, where accessible, was examined and found to be well clipped and in good condition.

In conclusion, all the fully charged cylinders were reinstalled and the installation left in commission ready for immediate operation.

A.S. Yates.

Inspection Department

I.1883/ASY/BVT
11-10-49



© 2021

Lloyd's Register
Foundation

010519-010525-0087