

COPY

# LLOYD'S REGISTER OF SHIPPING



Port Bangkok.

25th May, 1962.

This is to Certify that I have  
Surveyed the Machinery of the M.V. "SAINURI",  
of Bangkok.

and that I will transmit to the Committee of Lloyd's Register of  
Shipping, London, a Report stating that all recommendations made by  
me in connection therewith have been carried out to my satisfaction; also  
that I will Recommend that in the case of this Vessel the following  
Survey Records be made in the Supplement to the Register Book

Temporary Repairs to Driving Gear Wheel with built-in spring  
coupling for Scavenging Air Blower,  
and that her Machinery Classification Record be continued in the Book.

The outer casings were cracked and twisted.

The springs were distorted.

The Gear Wheel Ring was - one half bent slightly in, the other  
half bent slightly out, teeth undamaged.

Parts now examined:

(C.S. items only)

The gear wheel to blower, teeth damaged.  
Hub worn and surface damaged.

Temporary Repair was carried out -

The gear wheel rims faired to circular shape.

Hub built up and dressed.

Remaining parts were supplied from spares.

On trials it was found to work satisfactorily.

A complete unit has been ordered from Makers and will be fitted  
on arrival.

*D.C. Knott*  
D.C. Knott,

Engineer Surveyor to Lloyd's Register

#### KEY TO ABBREVIATIONS

ABS	Auxiliary Boiler Survey	SGS	Steam Generator Survey
CS	Continuous Survey of Engines	SPS	Steampipe Survey
DBS	Donkey Boiler Survey	TS	Tailshaft Survey
ES	Engine Special Survey	TS(CL)	Tailshaft Survey—Continuous Liner
MBS	Main Boiler Survey	TSN	Tailshaft renewed
MES	Modified Survey of Oil Engines	TS(OG)	Tailshaft Survey—Oil Gland
OF	Fitted for oil fuel (date) FP above 150°F.		

This Certificate is issued upon the terms of the Rules and Regulations of the Society, which provide that:—

"While the Committees of the Society use their best endeavours to ensure that the functions of the Society are properly executed, it is to be understood that neither the Society nor any Member of any of its Committees is under any circumstances whatever to be held responsible for any inaccuracy in any report or certificate issued by the Society or its Surveyors, or in any entry in the Register Book or other publication of the Society or for any error of judgment, default or negligence of any of its Committees or any Member thereof, or the Surveyors, or other Officers or Agents of the Society."

(Cert. B.1.) 150m,5,60 (MADE AND PRINTED IN ENGLAND)

010537-010544-0175

