

Rpt. 8.

C O P Y

No. 18739

REPORT OF SURVEY FOR REPAIRS &C.

Port of SYDNEY. N.S.W.

Survey held at SYDNEY. N.S.W.

Date, First Survey 26/3/42, Last Survey 27/3/42.
No. of visits 2.

No. in Reg. Book.
32731

Steel T.S.S. "STRATHALLAN"
Owners:- P. & O. Steam Nav. Co.

London.

Docking, Hull and Rudder Repairs.

This vessel placed in dry dock, bottom cleaned, examined and found in good condition except 27 rivets slack in forward end bilge keel to shell bar, starboard side, now renewed and good. On port side, J10 and 11 shell plates, 2 rivets slightly leaking in each plate (in way of deep fuel oil tank) now caulked and seen tight. Rudder and pintles good except local pit holes in bottom rudder plating, now built up with electric welding and good. A mild steel plate 29" x 6" x 3/8" now electric welded on rudder lifting stop, the lift now being 1/8". Bottom recoated. Ventilators, hatches, coamings, decks, casings, windlass and steering gear in good condition.
In S.R. List:- Indented plating etc. (p.s.a.) Renew blow-down pipes in cofferdams at first opportunity. Indented plating sound and tight, but not dealt with at this port. Blow down pipes in cofferdams stated to have been repaired and reinforced with concrete at Bombay 9/41.

This vessel as far as seen is now in good condition, eligible in my opinion to remain as classed, and to have record of survey 3.42 noted in the Register Book, subject to "Indented plating etc. (p.s.a.)" and to "blow down pipes in cofferdams being renewed at first opportunity".

£3. 3. 0. 27/3/42.

(Sgd.) E. L. CARTWRIGHT.

*Class omitted and
renewed
7.42*



© 2021

Lloyd's Register
Foundation

010783-010790-0186