

Has screw/tube
shaft been drawn?
Has shaft been

Date of examn.

COPY

Ship's name

"MOBIL RADIANT"

Port

MEL

No. 20783

Last survey date 6.8.63

Class is subject to

The Outboard turbo generator turbine being specially examined at next dry docking and by 6.64.

Starboard main boiler examined for damage stated caused by side wall tube bursting. 38 side wall tubes found sagged and one tube split for about 18". All these tubes now renewed. The first 8 rear wall tubes from the inboard side bowed about 2" and some other tubes slightly bowed. Surveyor recommends they be examined at the next MBS.

IT IS SUBMITTED that this vessel is eligible to remain as classed subject to the rear wall tubes in the Starboard boiler being specially examined at the next Boiler Survey also subject as above.

End. E.2

must be stated above and on the interim certificate.)

Surveyor to Lloyd's Register of Shipping

Date of Committee

TUESDAY 10 SEP 1963

POSTING



© 2021

Lloyd's Register
Foundation

