

Ship's name

PENELOPE

Port

ROT

4-FEB 1964

No.

57239

Last survey date

5.11.63

Class is subject to

Propeller & screwshaft being specially examined  
& dealt with as necessary at next D.D.

Docking. Wear down before 3.7%  
after 1.2%

Screwshaft drawn but not examined & replaced  
by spare & spare propeller fitted. New Metalock  
repairs carried out to stern fork crack. The  
Sur. recommends the entry in SRL App to contain  
of a further entry he made re spare screwshaft.  
Interim entry of 10.63 now commenced. *Interim entry of 10.63 now commenced.   
Screwshaft found cracked in way of one bolt  
hub, repairs effected  
by stringing a ring on  
flange.*

It is submitted that this  
vessel is eligible for THE

RECORD.

MBS 1063 when the safety valves  
of the centre boiler have been adjusted under steam  
& the blr. examined under steam & TSC 10.63 now.  
without subject.

G.T.A. 27/1/64

SRL App.

Amend entry to read: Stern fork crack Metalocked  
6.61 & 10.63.

Insert: Spare screwshaft to be examined before  
being used.