

10 NOV 1964

Ship's name *CINDERELLA*Port *ROT*No. *59056*Class is subject to *:- NIL*Last survey date *4-9-64**Docking*

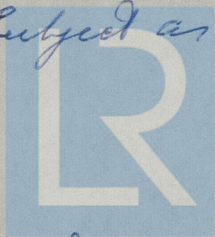
Wear down	{	Procr fitting spare shaft	4.0%
		after " " "	1.0%

*TS due 1/64, now held.**DBS due 7/64 now held.*

The Surveyor reports the tips of all propeller blades bent and damaged, the screw shaft found cracked at top of cone near keyway and shaft rejected. It previously used screw shaft with new liner fitted, cone crack detected and a few small hair cracks found at edge of keyway now ground out, propeller repaired and fitted. The Surveyor recommends the screw shaft cone be specially examined now Special Survey as by end of 1/65. (TS(CL) record 9/64 withheld)

The shell plates of donkey boiler have not yet been drilled in accordance with Lint 36 amendment 5. Stated this would be dealt with at Special Survey

It is submitted that this vessel is eligible for THE RECORD. DBS 9/64 now as record TS(CL) 9/64 withheld

Subject as recommended.

Lloyd's Register Foundation