

19 SEP 1958

Chief Ship Surveyor

Received from Chief Ship Surveyor

NAME "ATHAMAS"

REPORT

Alx.

No.

4954

remarks of the Chief Ship Surveyor are desired on this case for the consideration of the Classing Committee.

The endorsement to contain a succinct summary of any repairs that have been required and to show the cause or causes of such repairs, and also to bring out clearly any exceptional features in connection with the case, so that the Classing Committee may have all the salient points presented in the endorsement."—Extract from Sub-Committee's Report, 24/5/52.)

The class is subject to sternframe solepiece (E.W. 6,56) being specially examined next drydocking, with S.R.L. Appendix Note.

ACTION is DEFERRED for examination in dry dock on account of ice damage.

A SPECIAL SURVEY (C) became due 2,58.

The ALEXANDRIA Surveyor's reports (6,58), this ship examined afloat and in dry dock and the requirements of the Special Survey complied with.

On account of wear and tear repairs effected to shell plating etc.

Equipment - 45 fathoms of worn chain cable reported on board - 30 fathoms of Rule chain cable missing.

On account of grounding damage, fractured rudder post repaired and reinforced.

Repairs effected to shell plating etc. on account of grounding and H.W. damages.

On account of alterations -

- (a) 'Tween deck scupper valves removed etc.
- (b) In connection with 18" increase in draught, additional stiffening has been fitted to hold and 'tween deck frames, all in accordance with the requirements of Secretary's letter 'SHIP' dated 26.11.54.

IT IS SUBMITTED record of 'DS 5,58' be assigned, ~~as recommended~~, subject to fractured rudder post (E.W. & reinforced 6,58) being specially examined next drydocking, and to 45 fathoms of worn chain cable being renewed and 30 fathoms of chain cable supplied and verified at the earliest opportunity, without other condition, but further ACTION and NOTATION of 'SS Alx.7,58' be DEFERRED for Equipment.

DS 5,58 Subject Without.

Rule 270 fms  
WE 45"  
Max 90"



© 2021 P.T.O. //

Lloyd's Register Foundation

012203-012210-0091



S.R.L. APPENDIX NOTE (AMENDED).  
Soft nose stem plate indented.

C.S.S. Records Dept.

to note Fractured rudder  
- see sketch attn

NOTE:- It would appear that Items Nos. 1 & 4 of the Secretary's letter dated 26.11.54 require to be dealt with before the 18" additional draught can be granted.

IT IS FURTHER SUBMITTED the Owners be advised of the condition of class regarding equipment, and be requested to advise this Office what early arrangements they are making to place same in order.

FREEBOARD SURVEYORS TO NOTE this report re Alterations and safety equipment.

IT IS ALSO SUBMITTED the ALEXANDRIA Surveyors be advised that the Rule equipment consists of 270 fathoms of 2.5/16" dia. chain cable and as only 240 fathoms have been reported on board it is concluded that in addition to the 45 fathoms of worn chain cable to be renewed, 30 fathoms of missing chain cable require to be supplied to bring the chain cable up to Rule requirements. In view of this they should be requested to issue an amended Interim Certificate - see above.



© 2021

Lloyd's Register  
Foundation