

N/W "RINGFJELL"

Rpt. 8.

(Received at London Office)

No. 31

REPORT OF SURVEY FOR REPAIRS, &c.

Date of writing Report 22nd August 1948

When handed in at Local Office

Port of Nantes

No. in Survey held at Brest

Date, First Survey 13th JulyLast Survey 20th August 1948

Reg. Book 23583

(No. of Visits 6)

27781 on the Wood, Iron or Steel *wooden screw motor tanker "Kronform"*

TONNAGE:—

GROSS 9323

UNDER DK. 8649

NET 5550

Built at Odense

By whom Odense H. A. P. Møller

YEAR.

MONTH.

1935

8

Owners *Sold to Norway by French authorities*

OLSEN & UGELSTAD.

Address

(If not already recorded in Appendix to Register Book)

Managers

Port belonging to

Norwegian

Surveyed Afloat or in Dry Dock? *Dry dock*

Name of Dock Arsenal dry dock N°2

Destined Voyage Petroleum Trade

Cell DBor DBa feet; uE & B feet; f feet
al capacity tons. FPT tons; APT tons; MT feet tons.

Only alterations in the existing records of tanks should be inserted.

N.B.—All alterations in the existing records should be underlined.

ast Report, No. 3895 Port *Gul*

Periodical Surveys, when held, must be reported in detail and serially in the terms of the Rules and items remaining to complete the Surveys should be summarised. State clearly the cause of Repairs, if any, and, in detail, the nature and extent of Examinations and subsequent repairs. Repairs on account of Damage (the cause of which must be stated) should be separated from Repairs due to other causes; and besides being detailed in the body of the report, should be summarised in the form shown below. Whenever the replacement of Anchors or Chains is reported the particulars should be clearly stated in the space provided on the back of this form. State also the dates and initials of any letters respecting this case.

damage cases where the Surveyor has not made a special damage report he is required to state whether he offered his services for this purpose and to whom and why they were declined

Society's Freeboard (if assigned) as painted on Ship and now verified ft. ins.

Was a damage report made by anyone else? if so, by whom? *H. B. Møller & Co*

REPAIRS, OR EXAMINATION AS PER RULE, FOR *permanent or temporary repairs on the two parts of the vessel cut in two and made August 1944 by bomb action from enemy, and refloated in June 1945, in order to tow safely the two parts separately from Brest to Kiel.*

Found. Stern part. Starboard side 1 large hole in bilge plate and 2 plates above from frame 63 to 79. 1 large hole and bad indent in bilge plate and 2 plates above from frame 86 to 99. 1 large hole temporarily repaired welded steel box with internal stiffeners. 3 small holes aft. Several indents. Superstructure partly deformed. Port side 2 large holes temporarily repaired by external steel boxes, one with internal stiffeners, and the other with external stiffeners. 5 small holes plated over and welded. Several indents. Superstructure partly deformed. Rudder blocked at side.

Forward part. Starboard side 6 small holes plated over and welded. Several indents.

Port side 3 small holes plated over and welded. One very large indent not leaking. *P.T.O.*

MARY OF DAMAGE REPAIRS:—	Shell Plates.	Frames.	R. Frames.	Floors and Bracket Floors	Beams.	Inner Bottom Plates.	Dk. Plates.	Other Items:—
Renewed ...								
Removed and Faired or Repaired								
Faired or Repaired in place ...								

PRESENT CONDITION OF THE

Deck seem good	Bulkheads repaired	Engine Room Skylights panels broken	Copper, or Y.M. (State if on Felt.)
ing of Decks	Ceiling	Coal Bunkers, Openings, Covers, &c. broken	When fitted, Month Year
ings partly deformed	Cement or Asphalt	Oil Bunkers seem good	Boats <i>Morning</i>
is & Fastenings good	Rudder seem good	Scuppers good	Masts, Yards, &c. <i>do</i>
de Plating many holes & indents	Steering gear and its connections blocked up	Cargo Hatchways partly deformed	Condition, how ascertained (State if wedges removed.)
" in way of sidelights <i>do</i>	Windlass <i>scrubbed - dirty</i>	Hatches <i>winning</i>	Equipment letter <i>df</i>
es about 35 broken	Have pumps been examined and found efficient? <i>out of order</i>	Planking	Anchors, No. of <i>2 left</i>
se Frames	Have Sluice Valves been examined and found efficient? <i>out of order</i>	Caulking	Cables (State if now ranged)
itudinals	Have Watertight Doors been examined and found efficient? <i>blocked up</i>	Treenails	" length <i>2</i> mean diamr. <i>?</i> (on board.)
verses	Have Ventilators and their Coamings been examined and found efficient? <i>not good</i>	Breasthooks & Stemson	" Rule length <i>1</i> size
s seem good	Air and Sounding Pipes repaired	Transoms, Pointers & Crutches	Chain Locker <i>good</i>
ons <i>do</i>	Doubling Plates under Sounding Pipes	Timbers of Frame at openings	Hawsers & Warps <i>winning</i>
ers		" " at other places	Standing and Running Rigging <i>winning</i>
Bottom Plating seem good		Stringers, Clamps & Shelves	Sails
the Tanks been examined internally? <i>Yes</i>		Salting (State if examined.)	
the Tanks been tested? <i>No</i>			

General Observations, Opinion as to Class, Recommendation, &c.:— *The two separate parts of this*

State clearly whether any and, if so, what alteration is suggested to be made in the existing classification and notification of the vessel in the Register Book consequent upon this survey, thus, for example:—"to remain as classed in the Register Book without fresh record of Survey," "to remain as classed and to have record of survey, 1,38," or "to remain as classed and to have record of survey, 1,38, and the notations of ss No. 1-38."

vessel are now in sufficient condition for a long voyage in tow and can, in my opinion, be safely towed the forward part stem first and the stern part stern first, and by calm sea from Brest to Kiel. The "Kronform" could remain as now recorded in the Register Book with fresh annotations:

Sold to Norway - Saved up pending Survey - Reclamation contemplated

Survey Fee (per Section 29)	£	:	:	Fees applied for,
Special Damage or Repair Fee (if any) (per Sec. 29)	<i>frs</i>	:	28 :000	21/8 1948
Travelling Expenses (if chargeable)	<i>frs</i>	:	18 :000	Received by me,
Second Surveyor's Fee (if any)	£	:	:	19

Committee's Minute

FRI. 24 SEP 1948

Character Assigned

*Wise Kiel**Deferred*

Surveyor to Lloyd's Register of Shipping.

LLOYD'S REGISTER OF SHIPPING

Lloyd's Register

Foundation

012439-012445-0339

N.B.—If this Report is copied by Copying Press, especial care must be taken that the copying paper is not so much damped as to spread the ink, or to cause it to show through to the other side.

THE SURVEYORS ARE REQUESTED NOT TO WRITE ACROSS THIS MARGIN.

ANCHORS.

* When a bower anchor is supplied it must be clearly stated whether it is a 1st, 2nd, or 3rd bower.

[illegible]

Iron Stream Chain
or Steel Wire