

Spare gears checked and found to be in accordance with the rules requirement, except two Propeller blades are not supplied this time.

Note:- The Owners were informed and promised 2 spare blades be supplied within 6 months.

Repairs due to wear and tear :-

S. Boiler Surface blow valve box renewed.

Feed water pump, Weir's type, newly fitted, the particulars are as follows:-

Diam. of steam cylinder:- 220 m/m

Diam. of water cylinder:- 160 m/m

Stroke:- 450 m/m

No. of stroke:- 15/min.

Capacity:- 13 m³/hr.

3 lengths of feed pipes renewed.

Note:- The above materials examined, tested as per Rules and found sound and tight.

Electric cables; 2 CRLA 1/1.63 x 400 meter, 4 CRLA 1/1.63 x 350 metre renewed.

" " R.L. 1/1.6 x 500 meter, RL 7/0.8 x 100 meter installed for the new instal

Navigation lamps and indicator reconstructed (4 wire and 2 ,amp system) to meet Rules req

12 emergency lamps newly installed.

1st Entry Report No. and copy of Interim Certificate issued, attached hereto



© 2021

Lloyd's Register
Foundation