

012663 - 012668 - 0128

6m,9,61

Class is subject to

Combustion chamber tube plate and wrapper plates of  
Centre boiler (corroded) being specially examined  
at the next MBS. 4E

Received by Chief Engineer Surveyor

Received from Chief Engineer Surveyor

SHIP'S NAME

INCHCASTLE

REPORT KOB

No. 10520


MBS due 6/62 now partly held.

SQL The above items examined when boiler surveyed  
and the Surveyor recommended reports the shell plate,  
internally, at bottom found pitted, both furnaces corroded,  
smoke and stay tubes wasted also a considerable number of  
Combustion chamber stays and guides stays, both C.C.  
wrapper plates back end and tube plates wasted and  
he recommended the shell plate where pitted be wire brushed  
and coated with primer; both furnaces, all smoke and  
stay tubes, wasted C.C. stays and guides stays to be renewed,  
the ~~con~~ wrapper plates, and the wasted plates to be dealt with.

It is recommended the centre boiler not to be used  
until repaired

It is submitted that the  
vessel WILL BE eligible  
for the record MBS 5/62  
when the survey has been  
completed. as listed over

Subject as recommended and  
without subject above

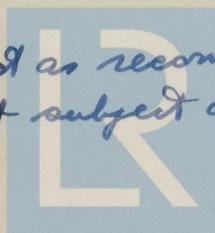

© 2021



Lloyd's Register  
Foundation  
8/6/62  
PTD

To Complete MGS +

Port & Starboard boilers to be examined  
in their entirety, the SV's of all three boilers  
to be adjusted under steam, oil burning  
system and remote controls examined  
working, and subject item dealt with

Lew



© 2021

Lloyd's Register  
Foundation