

COPY.

11 MAR 1935

Lloyd's Register of Shipping.



Port **GDYNIA**

8th February 1935

*(Class Contemplated)
(Vol. I Supp.)*

This is to Certify that

James C. Dykes

the undersigned Surveyor to this Society did at the request of Lloyd's Agents, Danzig and with the consent of the Builders attend on board the twin screw suction hopper dredger "CHIEN SHE" 4699 tons gross on the 19th January 1935 and subsequently for the purpose of ascertaining without prejudice the nature and extent of the following damages :

- I. Damage stated to have been sustained through grounding in the Pillau-Koenigsberg Canal on the 5th January 1935 while on trials.
- II. Damage stated to have been sustained through ice which she encountered in Pillau harbour, the Seetief and the Pillau-Koenigsberg Canal during her trials in January 1935.

For further particulars please see the Master's statements.

On examination of the vessel in dry dock at Danzig the undersigned found the following damage and made the accompanying recommendations : -

DAMAGE I.

FOUND :-

In the flanged bottom strake of the starboard inner hopper

This Certificate is issued upon the terms of the Rules and Regulations of the Society, which provide that :-

"While the Committee use their best endeavours to ensure that the functions of the Society are properly executed, it is to be understood that neither the Committee nor the Society are under any circumstances whatever to be held responsible for any inaccuracy in any report or certificate issued by the Society or its Surveyors, or in any entry in the Register Book or other publication of the Society, or for any error of judgment, default, or negligence of the Committee or any Member thereof, or the Surveyors, or other Officers or Agents of the Society."

11 MAR 5

- 2 -

win Se "CHIEN SHE"

Gdynia, 8th February 1935

side three plates were found vertically fractured in the solid material between frames 89 & 90, 99 & 100 and 109 & 110.

RECOMMENDED :

The three fractured plates to be cropped, partly renewed and fitted with internal butt straps partly rivetted and partly electrically welded.

To carry out this repair the following accessory work in way of the damage requires to be done : In the starboard inner hopper space 6 floor plates to be cropped, partly removed, replaced, butts to be closed by electric welding and floors fitted with angle reverse frames. Six floors to be removed, and replaced. Twelve bottom frames in the starboard inner hopper space to be cropped, partly removed and butts to be closed by electric welding. Six hopper doors to be removed and replaced and the oak hopper door framing in way of the damaged plates to be renewed with the corresponding leather tightening strips. The door frames to be resauled. Twelve attachment angles with small brackets for oak door frames to be removed, re-welded in position with several brackets to be renewed. Three hinges for bottom doors to be removed and re-rivettted in position. The repairs to be hose tested on completion. Twelve keel blocks to be removed and replaced. All feed water tanks to be drained and opened up for internal inspection. Cementing, cement wash and coating in way of the repairs to be renewed. All disturbed work in way of the damage to be replaced or made good.

ESTIMATED COST OF REPAIRS

	DANZ. GULDEN
Dry docking vessel and dock rent for one day (18th January 1935).	1475.00
Dry dock rent for eight days (19th to 26th Jan. 1935)	1800.00

To be carried forward	3275.00



© 2021
P.T.O.
Lloyd's Register
Foundation

0137 2/3

In Se "CHIEN SHE"

Gdynia, 8th February 1935

DANZ. GULDEN

Brought forward . . . 3275.00

Providing floating bridge, laying of electric cables,
compressed air piping etc. from the Yard of Messrs.
F. Schichau G.m.b.H. to the dry dock of Messrs. The
International Shipbuilding and Engineering Co. Ltd.,
Danzig 330.00

Damage Repairs 6270.00

Total cost as estimated : 9875.00

Note : The above estimate does not include charges for tug
assistance.

DAMAGE II

FOUND :

One stem plate near the waterline on the starboard side
indented. The suction piping in the starboard inner hopper space
fractured in way of three electrically welded butts.

RECOMMENDED :

The stem plate to be faired in place. The pipe butts to be
chiselled out, rewelded and fitted with electrically welded straps.
The repairs to be recoated.

The cost of the above repairs is estimated at Danz. Gulden 390.00

The recommendations relative to damages Nos. I & II have
been carried out to the satisfaction of the undersigned.

Fee including expenses : £16. 6. 0 (Sixteen pounds and six shillings).



James C. Dykes
Surveyor to Lloyd's Register
of Shipping



© 2021

Lloyd's Register
Foundation

1832
1832
1832

© 2021

Lloyd's Register
Foundation

00.0730
00.0730
00.0730

RECOMMENDED :
The above certificate does not indicate anything as to the
value of the property involved in the case.

[illegible]

1895
 1896
 1897
 1898
 1899
 1900
 1901
 1902
 1903
 1904
 1905
 1906
 1907
 1908
 1909
 1910
 1911
 1912
 1913
 1914
 1915
 1916
 1917
 1918
 1919
 1920
 1921
 1922
 1923
 1924
 1925
 1926
 1927
 1928
 1929
 1930
 1931
 1932
 1933
 1934
 1935
 1936
 1937
 1938
 1939
 1940
 1941
 1942
 1943
 1944
 1945
 1946
 1947
 1948
 1949
 1950
 1951
 1952
 1953
 1954
 1955
 1956
 1957
 1958
 1959
 1960
 1961
 1962
 1963
 1964
 1965
 1966
 1967
 1968
 1969
 1970
 1971
 1972
 1973
 1974
 1975
 1976
 1977
 1978
 1979
 1980
 1981
 1982
 1983
 1984
 1985
 1986
 1987
 1988
 1989
 1990
 1991
 1992
 1993
 1994
 1995
 1996
 1997
 1998
 1999
 2000
 2001
 2002
 2003
 2004
 2005
 2006
 2007
 2008
 2009
 2010
 2011
 2012
 2013
 2014
 2015
 2016
 2017
 2018
 2019
 2020
 2021
 2022
 2023
 2024
 2025
 2026
 2027
 2028
 2029
 2030
 2031
 2032
 2033
 2034
 2035
 2036
 2037
 2038
 2039
 2040
 2041
 2042
 2043
 2044
 2045
 2046
 2047
 2048
 2049
 2050
 2051
 2052
 2053
 2054
 2055
 2056
 2057
 2058
 2059
 2060
 2061
 2062
 2063
 2064
 2065
 2066
 2067
 2068
 2069
 2070
 2071
 2072
 2073
 2074
 2075
 2076
 2077
 2078
 2079
 2080
 2081
 2082
 2083
 2084
 2085
 2086
 2087
 2088
 2089
 2090
 2091
 2092
 2093
 2094
 2095
 2096
 2097
 2098
 2099
 2100
 2101
 2102
 2103
 2104
 2105
 2106
 2107
 2108
 2109
 2110
 2111
 2112
 2113
 2114
 2115
 2116
 2117
 2118
 2119
 2120
 2121
 2122
 2123
 2124
 2125
 2126
 2127
 2128
 2129
 2130
 2131
 2132
 2133
 2134
 2135
 2136
 2137
 2138
 2139
 2140
 2141
 2142
 2143
 2144
 2145
 2146
 2147
 2148
 2149
 2150
 2151
 2152
 2153
 2154
 2155
 2156
 2157
 2158
 2159
 2160
 2161
 2162
 2163
 2164
 2165
 2166
 2167
 2168
 2169
 2170
 2171
 2172
 2173
 2174
 2175
 2176
 2177
 2178
 2179
 2180
 2181
 2182
 2183
 2184
 2185
 2186
 2187
 2188
 2189
 2190
 2191
 2192
 2193
 2194
 2195
 2196
 2197
 2198
 2199
 2200
 2201
 2202
 2203
 2204
 2205
 2206
 2207
 2208
 2209
 2210
 2211
 2212
 2213
 2214
 2215
 2216
 2217
 2218
 2219
 2220
 2221
 2222
 2223
 2224
 2225
 2226
 2227
 2228
 2229
 2230
 2231
 2232
 2233
 2234
 2235
 2236
 2237
 2238
 2239
 2240
 2241
 2242
 2243
 2244
 2245
 2246
 2247
 2248
 2249
 2250
 2251
 2252
 2253
 2254
 2255
 2256
 2257
 2258
 2259
 2260
 2261
 2262
 2263
 2264
 2265
 2266
 2267
 2268
 2269
 2270
 2271
 2272
 2273
 2274
 2275
 2276
 2277
 2278
 2279
 2280
 2281
 2282
 2283
 2284
 2285
 2286
 2287
 2288
 2289
 2290
 2291
 2292
 2293
 2294
 2295
 2296
 2297
 2298
 2299
 2300
 2301
 2302
 2303
 2304
 2305
 2306
 2307
 2308
 2309
 2310
 2311
 2312
 2313
 2314
 2315
 2316
 2317
 2318
 2319
 2320
 2321
 2322
 2323
 2324
 2325
 2326
 2327
 2328
 2329
 2330
 2331
 2332
 2333
 2334
 2335
 2336
 2337
 2338
 2339
 2340
 2341
 2342
 2343
 2344
 2345
 2346
 2347
 2348
 2349

"H"

(78. in.)
should be

