

Received by Chief Ship Surveyor.....

Received from Chief Ship Surveyor..... 1 SEP 1941

VESSEL'S NAME..... JOHN..... Rpt. Got No. 13188

The remarks of the Chief Ship Surveyor are desired on this case for the consideration of the Classing Committee.

("The endorsement to contain a succinct summary of any repairs that have been required and to show the cause or causes of such repairs, and also to bring out clearly any exceptional features in connection with the case, so that the Classing Committee may have all the salient points presented in the endorsement."—Extract from Sub-Committee's Report, 24/5/92.)

The class is subject to indented plating (p.s) being dealt with at Owners' convenience.

The GOTHENBURG Surveyors now report the vessel placed in dry dock, bottom coated, and on account of damage through grounding, ice, heavy weather, striking quay, etc., extensive renewals and repairs effected to shell plating, framing and decks.

The indented plating, as above, has been dealt with.

The 2nd S.S. No. 1, due 1.41, has been held and considerable repairs carried out.

The length of the bridge superstructure, || has been increased as per approved plan attached.

A bower anchor and 30 fathoms of chain cable have been lost, and owing to the increase in equipment due to the above alteration the new bower anchor should be 49 cwts. and an additional 15 fathoms of chain cable supplied, together with 100 fathoms of 4½" steel wire. (See endorsement attached)

It is submitted action be deferred for equipment.

Insert in S.R.L:- A bower anchor (49 cwt. stockless), 45 fms. 1.15/16" chain cable and 100 fathoms of 4½" steel wire to be supplied.

Delete from S.R.L:- Indented plating as above.

Amend in R.B:- B 98' to B 151'

In R.B:- Delete equipment letter and insert 1.15/16".

(DOCKING DATE 5.41)

PLATING to be DRILLED when vessel is 24 years old, or at next Special Survey thereafter.

The Surveyors should be informed that when the equipment has been placed in order the notation of Special Survey will be assigned and the certificate issued.

015039-015053-0311

© 2021

Lloyd's Register
Foundation