





left: Nelson's outfit to the  
Yukon P. house left to the  
outfit

The following recommendations were made by the Board of Directors of the American Association of University Professors:



It was then recommended that the rudder head be straightened as far as possible, and the whole of the pintles carefully overhauled and lightened up where required, and that the broken parts of the gudgeon or sternpost be cut away and a strong and neat steel band fitted right around the full depth of gudgeon, brought well in over the post and riveted through all, and the gudgeon rebored.

On further survey of the vessel in the Alexandria dry dock in this port on the 6<sup>th</sup> July, found the fore end of the foremost flat keel plate indented about three fourths of an inch, the landing rivets started and the hull slightly scored. The third plate in the foreward (A) strake slightly indented at the upper landing, the hull immediately above in B strake forced in a little and the fourth plate in B strake slightly indented and scored at the fore end - all on the starboard side, and the paint rubbed off a few places each side.

The following recommendations were then made, viz. that the whole of the indented plates be forced in place, and the rivets in row of same carefully tested and renewed where necessary, also that the cement be renewed where broken, the



© 2019

Lloyd's Register  
Foundation

BEL 69-0027 (3/4)



refitted where disturbed, and the damaged  
plates and scrubbed parts of bottom re-  
painted, so as to place the vessel in as  
good condition as she was in before the  
damage occurred.

Dec £ 4. 4. 0  
Less 10%  $\frac{0. 2}{2}$   
£ 3. 16. 0

James Curpin

Paid 27/8/98  
M. 8. 5. 8  
29. 8. 5. 8



© 2019

Lloyd's Register  
Foundation

BEL69-0027(1/4)