

2

Received by Chief Ship Surveyor

3/1/06

Received from Chief Ship Surveyor

VESSEL'S NAME

St S. Electra

Report

Dun

No.

7119

The remarks of the Chief Ship Surveyor are desired on this case for the consideration of the Classing Committee.

("The endorsement to contain a succinct summary of any repairs that have been required and to show the cause or causes of such repairs, and also to bring out clearly any exceptional features in connection with the case, so that the Classing Committee may have all the salient points presented in the endorsement."—Extract from Sub-Committee's Report, 24/5/92.)

Nature of Survey

S.S. No.

2

The

S.S. No.

2

has now been held, and the following repairs

done (due to *Wear & tear*) :- rudder bushed, running
deck planking ^{partly} renewed, main deck sheathing partly
renewed, one stroke of deck plating on each side of
80 ft casing & the plating under donkey boiler renewed,
7 floors renewed, 3 beams part renewed, a number
of frame frames repaired, running deck chumstrate
doubled for a length of 30 ft, the hawse pipe renewed,
120 fms of chain cable of proper size, bought & stowed
for ^{future repairs}.

It is submitted the vessel is worthy to remain classed

with record of Survey *12-05* and notation of S.S.

No 2-05 P.N.D. 05 as recommended.


100A1

Running deck with fms

12-05 Dun

St Dun No 2-05

P.N.D. 05

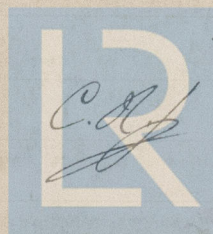

R.R.

3/1/06

Lloyd's Register
Foundation

DUN130B-0121