

2171

REPORT of SURVEY for REPAIRS.

No. 2171 Survey held at Androssan Date 8th April 1864
on the "Star" Master Sam. Dean

Tonnage 74 Built at Milford When built 1833

By whom built _____ Owners O'Conner

Port belonging to _____ Destined Voyage Coaster

If Surveyed Afloat or in Dry Dock Russell's Floating dock

Last Survey, No. 795 Port Gloster Classed 10. A. 1
4.61.

REPAIRS of damage

Renewed; Upper piece of Stem, three Timbers on Port-bow, one Breast Hook and two Deck Beams, all with British Oak; six Fore hoods on Port-bow with Red Pine; four Lodging Strees to Beams, two of iron & two of oak; and about 300 feet of deck renewed with Yellow Pine. Windlass unhung, stripped, examined & found good; the vessel recaulked from Keel over all.

Present Condition of the

| | | |
|---|--|--|
| Decks <u>good</u> | Treenails <u>good</u> | Windlass and Capstan <u>good</u> |
| Waterways <u>whew</u> | Breasthooks and Stemson <u>whew</u> | Pumps <u>whew</u> |
| Comings <u>whew</u> | Transoms, Pointers, and Crutches <u>whew</u> | Boats <u>whew</u> |
| Upper Deck Beams & Fastenings <u>whew</u> | Timbers of the Frame <u>whew</u> | Masts, Yards, &c. <u>whew</u> |
| Lower Deck Beams & Fastenings <u>seen</u> | Keelsons <u>seen</u> | Sails <u>sufficient</u> |
| Planksheers <u>whew</u> | Clamps and Shelves <u>whew</u> | Anchors No. of <u>whew</u> |
| Sheerstrakes <u>whew</u> | Ceiling <u>whew</u> | Cables <u>whew</u> |
| Topsides <u>whew</u> | Rudder <u>whew</u> | Hawsers and Warps <u>whew</u> |
| Wales <u>whew</u> | Copper <u>none</u> When put on <u>whew</u> | Standing & Running Rigging <u>whew</u> |
| Plank (Bottom) and Counter <u>whew</u> | | |

General Observations and Opinion,

Caulking of Bottom, Deck, & Waterways.

good whew tested
The vessel is now in good & efficient condition, eligible in my opinion to remain as classed A. 1.

The Amount of Fee.....£ : 10 : 0 is received by me,

Special..... 1 : 1 : 0


Certificate (if required) : 2 : 6

Committee's Minute 6th May 1864

Character assigned A. 1

second damage repair

MA

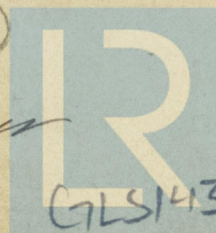

© 2019

Lloyd's Register Foundation

GLS143-0264