

REPORT of SURVEY for REPAIRS, &c.

No. 11158

Date of writing Report: 11 Dec 91 When handed in at Local Office: 18 Port of Glasgow 11 DEC 91
 No. in Reg. Book: 227 Survey held at Glasgow Date, First Survey: 22 Oct 19 Last Survey: 30 Nov 1891
 on the "Gladiator" (No. of Visits) Master: Kerr

TONNAGE:— Built at Stockton By whom: D. MacBrayne Owners: D. MacBrayne Port belonging to Glasgow
 GROSS 659 Owners' Address: (if not already recorded in Appendix to Register Book.)
 UNDER DK. 561
 NET 422
 Surveyed Afloat or in Dry Dock? Both Name of Dock: Both Name of Dock: Both
 WB=DBa tons; f tons; uE&B tons; CellDB tons; FPT tons; APT tons; MT tons.

Last Survey, No. 1970 Port Nam
 Particulars of Classification (which must be inserted precisely as in Register Book & Supplements).
 CHARACTER. * for Special Survey. Date of last Survey and of Periodical Surveys. Years Assigned now expired. Machinery and Boiler Surveys (including date of N.B., if any).
 +90 A.1. 6.91 L.M.C. 2.88 B.S. 6.91
 S.S. 96 Nov. 88 S.S. 103. 8.84
 Society's Freeboard (if assigned) as painted on Ship and now verified

REPAIRS, OR EXAMINATION AS PER RULE, FOR Alterations & Repainting. Repairs caused by deterioration.

The outside examined, scraped & repainted. The whole of the close ceiling in the main hold renewed of 2 1/2 inch pitch pine, also a large portion of the spar of 2 white pine. Three hold beams, and the angles to the others renewed. New intermediate beams of 7 x 5 x 7/16 angle built. now fitted. Coatings to lower main hatchway, & two plates at after end of hold pack side to the lower deck stringers renewed. and a new deck flat laid of 3 white pine. Five new pillars fitted & six straightened. Twelve feet of new rudder plate fitted under main hatchway to middle line keelson. Two new transverse pipes fitted. The former ones were fitted below upper deck & the holes have now been efficiently closed by means

SUMMARY OF DAMAGE REPAIRS: —		Plates, Paired or Repaired: —	Frames, ditto. ^(4 Stringers) Plates, Renewed: — ^(7 2 doubling)	Other Repairs ^{5 new hold beams & new lower deck, close ceiling & hawsers.}			
PRESENT CONDITION OF THE							
Decks	good	Transoms, Pointers, & Crutches	good	Copper, or Y.M.	✓	Hatches	good
Waterways	4	Timbers of Frame at the openings	4	(State if on felt.)		Boats	4
Coamings	4	Ditto ditto at other places	4	When put on, Month	Year	Masts, Yards, &c.	4
Up'r Dk. Beams & Fastenings	4	Keelsons	4	Rudder	good	Condition, how ascertained	From 1891
Low'r Dk. Beams & Fastenings	4	Clamps, Shells & Stringers	4	Windlass & Capstan	4	Sails	good
lating	4	Salting	4	Pumps	4	Anchors No. of	38. 1/2 Dk
Planking	✓	Ceiling	good	Engine Room Skylights	4	Cables, length	— size 4
Transoms or Rivets	4	Cement or Asphalt (State which.)	4	Coal Bunker, Open'gs, Lids, &c.	4	(State if now ranged)	4
	4	Tanks (State if now tested.)	4	Scuppers	4	Hawsers & Warps	4
	4	Caulking of Bot'm, D'k, & Wat'r'w'ys	good	Cargo & Main H'tch'w'ys	4	Standing & Running Rigging	4

General Observations, Opinion as to Class, Recommendation, &c.:—
 State clearly whether any and, if so, what alteration is suggested to be made in the existing classification and notification of the vessel in the Register Book consequent upon this survey, thus, for example:— "to remain as now classed in the Register Book without fresh record of Survey," "to remain as classed and to have record of survey, 9,91," or "to remain as classed and to have record of survey, 9,91, and the notations of ss No. 1-91 and ptND91, &c."

This vessel is in good condition in my opinion eligible to remain as classed & to have record of survey 11. 91

Office Fee (if chargeable) per Scale II., Sec. 27 £ : : Fees applied for, 18
 Survey Fee (per Section 28) £ : : Received by me, 18
 Special Damage or Repair Fee (if any) (per Sec. 28.) £ : :
 Travelling Expenses (if chargeable) £ : :
 Second Surveyor's Fee (if any) £ : :
 Is Certificate now required?
 Committee's Minute
 Character assigned
 TUES. 15 DEC 1891
 90A1
 n891 24p91
 Surveyor to Lloyd's Register of British & Foreign Shipping.
 © 2019 Lloyd's Register Foundation

rt of

Glasgow

Continuation of Report No. 11158 dated 30th Novem^r 1891 on the

O. P. "Gadiator".

of outside doubling; the plating in way of the present
pipes have also been doubled. Sub butwart plates
port side amidships renewed & new gangway door fitted
on the starboard side. New solid hatches fitted. 3
thick

LD



© 2019

Lloyd's Register
Foundation

GLS163-0310 (2/2)