

## REPORT of SURVEY for REPAIRS, &amp;c.

Date of writing Report *26th Aug. 92* When handed in at Local Office *26th Aug. 92* Port of *Glasgow*No. in Reg. Book *234* Survey held at *Ayr* Date, First Survey *13th Aug. 91* Last Survey *24th Aug. 1892*Built at *Newcastle* By whom *C. S. Brown & Hunter* When *1882* 8  
Owners *W. S. G. of Glasgow (him)* Port belonging to *London*  
Owners' Address  
(if not already recorded in Appendix to Register Book.)Surveyed *Afloat in Dry Dock* on *Slip* Name of Dock *Ayr* Destined Voyage *Cronstadt*  
WB=DBa tons; f tons; uE&B tons; Cell DB tons; }  
FPT tons; APT tons; MT tons; }Last Survey, No. *1456* Port *Brew*

(Periodical Surveys, when held, must be reported in detail and serially in the terms of the Rules. State clearly the cause of Repairs, if any, and, in detail, the nature and extent of Examinations and subsequent Repairs. Repairs on account of Damage (the cause of which must be stated) should be separated from Repairs due to other causes; and besides being detailed in the body of the report, should be summarised in the form shown below. Whenever the replacement of Anchors or Chains is reported, the particulars of weight or size and test of the articles should be clearly stated, and also the weight or size, &amp;c., required by the Rules, together with the vessel's Equipment Letter, if any. State also the dates and initials of any letters respecting this case.)

REPAIRS, OR EXAMINATION AS PER RULE, FOR *on account of damage through grounding.*  
On starboard side forward, 1 garboard plate taken off, faired, and replaced, and 1 faired in place; 3 plates and 3 butt-straps of B stroke new, and 1 plate faired in place; 2 plates and 1 butt-strap of C stroke new, and 1 plate faired in place; 1 frame faired in place and doubled for a length of 3 ft; and 30 rivets through frames and floors renewed.  
On port side forward, 3 plates and 3 butt-straps of B stroke new, and 1 plate faired in place; 3 plates of C stroke partly unriveted, faired in place, and re-riveted. 20 rivets renewed on each side in flat of bottom, and the landing edges and butts recaulked in a few places. The tank in after hold cleaned out and the cement renewed in several places. The ceiling, which was removed to admit of repairs being effected, replaced and about 30 ft. of it to be renewed. The cement in way of repairs made good. The tank in fore hold tested with water to the height of the light water line and (over)SUMMARY OF DAMAGE REPAIRS: — 8 Plates, Faired or Repaired; 1 Frame, ditto. 8 Plates, Renewed; 1 Frame, ditto. Other Repairs. *Minor as above.*PRESENT CONDITION OF THE  
Transoms, Reins & Crutches. *Good*  
Timbers of Frame at the openings. *Good*  
Ditto ditto at other places. *Good*  
Keelsons. *Good*  
Clamps, Shells & Stringers. *Good*  
Salting. *Good*  
Ceiling. *Good*  
Cement on Deck. *Good*  
Tanks. *Not tested*  
Caulking of Bot'm, D'k, & Wat'rwys. *Good*  
Copper, or Y.M. *Good*  
(State if on Felt.)  
When put on, Month. *Good* Year. *Good*  
Rudder. *Good*  
Windlass & Capstan. *Good*  
Pumps. *Good*  
Engine Room Skylights. *Good*  
Coal Bunker, Open'gs, Lids, &c. *Good*  
Scuppers. *Good*  
Cargo & Main H'tch'wys. *Good*  
Hatches. *Good*  
Boats. *Good*  
Masts, Yards &c. *Good*  
Condition, how ascertained. *From deck*  
Sails. *Good*  
Anchors No. of *2 B. 1 S. 2 K. as remarks.*  
Cables, length. *Good* size. *Good*  
(State if now ranged. *Not ranged*  
Hawsers & Warps. *Good*  
Standing & Running Rigging. *Good*

General Observations, Opinion as to Class, Recommendation, &amp;c.:—

State clearly whether any, and if so, what alteration is suggested to be made in the existing classification and notification of the vessel in the Register Book consequent upon this survey, thus, for example:—"to remain as now classed in the Register Book without fresh record of Survey," "to remain as classed and to have record of survey, 9,91," or "to remain as classed and to have record of survey, 9,91, and the notations of ss No. 1-91 and ptND91, &amp;c."

*This vessel is in good and efficient condition, and, when a first lower anchor has been supplied, will in my opinion be eligible to remain as classed and to have record of survey, Aug 8, 92.*Office Fee (if chargeable) per Scale II., Sec. 27. £ : : Fees applied for, *26/8 18.92*  
Survey Fee (per Section 28) £ : : Received by me, *29/8 18.92*  
Special Damage or Repair Fee (if any) £ 3 : 3 :  
Travelling Expenses (if chargeable) £ 1 : 9 :  
Second Surveyor's Fee (if any) £ : :  
\*Is Certificate now required? *No*Committee's Minute *FR 2 SEP 1892*  
Character assigned *Deferred for*  
*W. S. G. 92*  
*White Bw 24/9/92*  
*Comp. of 2 aft.*  
*100A*  
*1st to 2nd 20/10/92*

X.B.—All alterations in the existing records should be underlined.

GL5166-0021



12/11

11721 glo

found satisfactory. The bottom cleaned and recoated.

\* This vessel lost her first lower anchor some time ago, and the Owners advise us that a new one will be supplied at Barrow, for which port the vessel has sailed. We have advised the Surveyors at Barrow.

Jo: Thomson

1 A 001 +

92-214-10211

N.B.—If this Report is copied by Copying Press, especial care must be taken that the copying paper is not so much damped as to spread the ink, or cause it to show through to the other side.

THE SURVEYORS ARE REQUESTED NOT TO WRITE ACROSS