

Received by Chief Surveyor 6. 11. 99

Received from Chief Surveyor _____

VESSEL'S NAME S.S. "Clam"

Report Spl. No. 11039

The remarks of the Chief Surveyor are desired on this case for the consideration of the Classing Committee.

("The endorsement to contain a succinct summary of any repairs that have been required and to show the cause or causes of such repairs, and also to bring out clearly any exceptional features in connection with the case, so that the Classing Committee may have all the salient points presented in the endorsement."—Extract from Sub-Committee's Report 24/5/92.)

Nature of Survey Damage repairs, Reinstatement of Class. S.S. No. 3 1/2.

This vessel stranded near Algiers in May last. She was refloated and towed to Algiers.

The case was before the Committee on 26th. May, and the class 100A1 was expunged from the Register Book, and a record of "Stranded & Refloated 5.99" inserted against the vessel's name.

The Hartlepool Surveyors now report that the following repairs have been done ;— Lower part of stem renewed, and upper part faired and refitted; rudder rebushed; 78 plates renewed; 13 taken off, faired and replaced and 38 faired in place; 96 frames and 80 reverse frames partly renewed; 18 frames and reverse frames faired in place; 70 floors renewed; 11 partly renewed; 14 removed faired and replaced, and 4 faired in place; 4 beams renewed, and 2 removed faired and replaced; 7 deck plates renewed, and 5 removed, faired and replaced; 4 centre girder plates renewed; middle line and fore peak bulkheads repaired; bilge keelson and lower side tank top plating at fore end renewed; stringers in fore peak renewed; cement made good; ceiling in fore hold renewed; windlass and steering gear overhauled; a new steel wire hawser, and 3 boats supplied, and various minor repairs.

One bower anchor is stated to have been broken at Port Said and the Owners' Superintendent states that a new anchor is at that port waiting to be placed on board the vessel when she calls there after leaving Batoum.

The S.S.No.3 has been partly held and the following repairs

HPL387-0160 (1/3)

A letter has since been received from the Owners stating that they have given their Captain instructions to attend to the completion of the survey at first port where the Society has a Surveyor, and they fully expect this may be done at Singapore.

It is submitted the Singapore Surveyor be advised.

J.S.
9.11.99

C.S.P.
9/11/99

It is submitted that a letter has now been received from the Owners stating that Oil fuel apparatus will be put in use at Suez & for some considerable time ^{they} will continue to burn this fuel, although, until arrangements are completed both in the far East & here it may be occasionally necessary to burn Coal. ~~The Suez Surveyor should therefore be advised.~~ As the Society has no Surveyor at Suez the Owner should be requested to inform this office when the liquid fuel is actually being used.

J.S.
10.11.99



© 2019

Lloyd's Register
Foundation

HPL387-0160 (3/3)