

2148

REPORT of SURVEY for REPAIRS.*of Damage*

Rec. 21/5/60

No. 2021 Survey held at West Hartlepool Date 10th May 1860
 Supp. on the Ship S.S. "Thornaby" Master E. Child
 Tonnage 457 Built at West Hartlepool When built 1859
 By whom built _____ Owners West. Ry. Ste. Co.
 Port belonging to West Hartlepool Destined Voyage Hamburg
 If Surveyed Afloat or in Dry Dock Afloat in West Dock

Last Survey, No. 1969 Port Iron Classed 12 A 1

REPAIRS (In consequence of burning) Two deck beams the rivets of angle irons taken out the same heated set fair & re-riveted. One beam cut & a new middle piece fitted with double angle iron 6x3x7/16. Two short lengths of deck tie plates renewed. Decks foreward renewed with yellow pine, Foremast partners new 5 in Teak. Fore mast new Red Pine, Fore hold scraped out from deck beams to bilge & re-painted. Decks caulked from after part of fore hatchway thence foreward.

Present Condition of the

Decks	Tree nails <u>Rivets</u>	Windlass and Capstan
Waterways	Breasthooks and Stemson	Pumps
Comings	Transoms, Pointers, and Crutches	Boats
Upper Deck Beams & Fastenings	Timbers of the Frame	Masts, Yards, &c.
Lower Deck Beams & Fastenings	Keelsons	Sails
Planksheers	Clamps and Shelves	Anchors No. of
Sheerstrakes	Ceiling	Cables
Topsides	Rudder	Hawsers and Warps
Wales	Copper _____ When put on _____	Standing & Running Rigging
Plank (Bottom) and Counter		

General Observations and Opinion,

Caulking of Bottom, Deck, & Waterways. Good

Is now in good condition and eligible in our opinion to remain as now classed 12 A 1

The Amount of Fee.....£ 1 : " : " is received by me,

Damage Survey Special..... 2 : 2 : "

Certificate (if required) : " : "

Committee's Minute 22nd May 1860Character assigned 12 A 1*record damage repair**SH*

© 2019

Lloyd's Register Foundation

IRON 434-0243