

REPORT of SURVEY for REPAIRS.

No. in Reg. Book. **No.** 170 Survey held at London Date April 28th 18 66
 on the Screw Steamer "Peninsula" Master 221
 Tonnage 379 Built at London When built 1853
 By whom built 2366 Owners Messrs Hall & Co
 Port belonging to London Destined Voyage Gibraltar
 If Surveyed Afloat or in Dry Dock Union Dry Dock R.

Last Survey, No. 2089 Port Iron. Classed 6 - C 3 - 61
 REPAIRS Since her class expired she has received at various

times the following repairs - viz - The after lengths of the
Main Deck Waterway renewed with Keel Pine. Stringer
Plate in way of them found good - One Starboard
Topside plate in Amidships renewed - Five Floor plates in
the Hold doubled and the Centre parts of twelve others
renewed with 3/8 plate - About 400 rivets renewed in the
Garboard plates and other parts of the bottom. Several
of the bottom plates bored for the purpose of testing their
thicknesses - in every case they were found beyond the
minimum thickness allowed by the Rules - Her main deck
doubled with 1/2 in. S. I. - The Ceiling lifted in the Holds
the plating angle iron and rivets exposed found good the
Windlass stripped and examined found good and sufficient;
 Present Condition of the the Chains rapped, examined, and found good and
sufficient.

Decks	Treenails	Windlass and Capstan
Waterways	Breasthooks and Stemson	Pumps
Comings	Transoms, Pointers, and Crutches	Boats
Upper Deck Beams & Fastenings	Timbers of the Frame at the openings	Masts, Yards, &c.
Lower Deck Beams & Fastenings	Ditto Ditto at other places	Condition, how ascertained
Planksheers	Keelsons	Sails
Sheerstrakes	Clamps and Shelves	Anchors No. of
Topsides	Ceiling <u>lifted in the Holds</u>	Cables
Wales	<u>rivets, angle iron & plates found</u>	Hawsers and Warps
Plank (Bottom) and Counter	Rudder <u>where seen</u>	Standing & Running Rigging
	Copper	
	When put on	

General Observations and Opinion,

Caulking of Bottom, Deck, & Waterways.

We received an order to survey this vessel for Restoration.
Upon examining the Floor Plates under the Boilers and
stoke hole found them very badly wasted, the centres
of them being completely eaten away - the owner consequently
declined to proceed with the survey until a future period.

The Amount of Fee.....£ : : is received by me,

Special..... 3 : 3 :

Certificate (if required) : :

Committee's Minute 22nd May 18 66

Character assigned

Record date of Survey

Letter to owners
22nd May



© 2019

Lloyd's Register
 Foundation

IRON439-0350