

REPORT of SURVEY for REPAIRS.

No. in
Reg. Book.

No. 2223 Survey held at Liverpool Date, first Survey Aug. 17 Last Survey March 12 18 70

on the (S.S.) "Lake Superior" Master A. Ritchie

Tonnage 1274 built at Greenock When built 1868 - 12 mo

By whom built Steele Owners Canada L. Co.

Port belonging to Glasgow Destined Voyage Canada

If Surveyed Afloat or in Dry Dock Afloat - & in Clarence graving dock

Last Survey, No. 6833 Port Iron. Classed A-8

REPAIRS, &c. done through damage -

Port-side Amidships - One garboard plate & three plates in
flap of bottom also the additional frame to floor plate renewed;
one frame part-renewed, one plate in flat of bottom taken off
straightened, & refitted, & the bottom scraped & coated with
red lead paint.

Present Condition of the

Decks	Treenails <u>Rivets</u>	Windlass and Capstan <u>Good & efficient</u>
Waterways	Breasthooks and Stemson	Pumps <u>" "</u>
Comings	Transoms, Pointers, and Crutches	Boats <u>" "</u>
Upper Deck Beams & Fastenings	Timbers of the Frame at the openings <u>seen</u>	Masts, Yards, &c. <u>" "</u>
Lower Deck Beams & Fastenings	Ditto Ditto at other places <u>seen</u>	Condition, how ascertained <u>Seen from deck</u>
Planksheers	Keelsons	Sails <u>" "</u>
Sheerstrakes	Clamps and Shelves	Anchors No. of <u>Good & efficient</u>
Copsides	Ceiling <u>Good where seen</u>	Cables <u>" "</u>
Wales	Rudder	Hawsers and Warps <u>where seen</u>
Plank (Bottom) and Counter	Copper Cement - When put on <u>68</u>	Standing & Running Rigging
Engine Room Skylights	Caulking of	Cargo and Main Hatchways <u>Good</u>
Coal Bunker, Openings, Lids, &c.	Bottom, Deck, & Waterways <u>Satisfactory</u>	Hatches <u>Good</u>
General Observations and Opinion,	Scuppers <u>Good</u>	

I now in an efficient condition & in my opinion
eligible to remain as Classed

The Amount of Entry Fee.....£ 1 : : : is received by me,

Special.....£ 2 : 2 : : 22/3/70

Certificate (if required) : 5 :

Committee's Minute Liverpool 22nd March 1870

Character assigned A-1 - Record damage repairs

Damage due £2.2.0 on 22/3/70

© 2019

Lloyd's Register
Foundation

IRON 446 - 0033

REPORT OF SURVEY FOR REPAIRS

"Lake Superior"

22,234-



© 2019

Lloyd's Register
Foundation