

REPORT of SURVEY for REPAIRS.

of Damage

Rec'd 16/10/71

No. in Reg. Book. **No. 10214** Survey held at Sunderland Date March 11th & 12th 1870
 on the Iron S.S. "Holloe" Master _____

Tonnage 500 built at Sunderland When built 1866
 By whom built 340 Laird Owners J. Foster
 Port belonging to London Destined Voyage Hamburg
 & Surveyed Afloat or in Dry Dock at 1 Graving docks

Last Survey, No. 9450 9667 Port Sunderland Classed A. 1 7. 69. 33. Nov 69

REPAIRS *of damage through ice - Scrimped two broken frames forward and two transverse frames. Renewed two broken beam knee plates, and the Hook plate.*

Renewed on the starboard beam two indented plates, reset and refitted the same. The plate said? has renewed. Some started rivets renewed and caulking in way of damage made good. Repaired bottom with black paint and new lead.

Present Condition of the

Decks	} <i>good</i>	Treenails <i>Rivets</i>	} <i>good</i>	Windlass and Capstan <i>Complete</i>
Waterways		Breasthooks and Stemson		Pumps <i>do</i>
Comings		Transoms, Pointers, and Crutches		Boats <i>do</i>
Upper Deck Beams & Fastenings		Timbers of the Frame at the openings		Masts, Yards, &c. <i>do</i>
Lower Deck Beams & Fastenings		Ditto Ditto at other places		Condition, how ascertained <i>do</i>
Planksheers	} <i>where</i>	Keelsons	} <i>where</i>	Sails <i>do</i>
Sheerstrakes		Clamps and Shelves		Anchors No. of <i>34. 1st & 2nd</i>
Topsides <i>Plating</i>		Ceiling		Cables <i>side to be complete</i>
Wales <i>do</i>		Rudder <i>do</i>		Hawsers and Warps <i>do</i>
Plank (Bottom) and Counter		Copper <i>do</i> When put on <i>do</i>		Standing & Running Rigging <i>do</i>

General Observations and Opinion,

Caulking of Bottom, Deck, & Waterways. *apparently good*

This vessel appears in good condition and eligible in our opinion to continue to class.

The Amount of Fee.....£ *0* : *0* : *0* is received by me,

Special..... *0* : *0* : *0*

Certificate (if required) *0* : *0* : *0*

Committee's Minute _____ 18__

Character assigned _____

N.B. The late owner declined to have the vessel surveyed (see Report No. 10215 and previous)



© 2019

Lloyd's Register Foundation

120N449-0363