

REPORT of SURVEY for REPAIRS, &

in Book. No. 10 Survey held at *London* Date, first Survey *Jan 16th* Last Survey *July 16th*

on the *BK Terulam*

Master

TONNAGE under Tonnage Deck *303*

Ditto of Spar Deck, or Awning Deck

Ditto of Poop

Ditto of Raised Qr. Dk.

Ditto of Houses on Deck

Ditto of Forecastle

Gross Tonnage

Crew Space, as per Rule

Register Tonnage, cut on Beam

Engine Room

Reg. Tons as St' mer, cut on Bm.

Built at

When built

YEAR.

MONTH.

Owners

Port belonging to

Residence

By whom built

Destined Voyage

If Surveyed Afloat or in Dry Dock

Length of Poop

ft.

Ditto, Forecastle

ft.

Ditto, Raised Quarter Deck

31

ft.

Years assigned.

Character in Register Book

Last Survey, No. *16075*

Port *Iron*

Classed

100 A 1.76

REPAIRS, OR EXAMINATION AS PER RULE

Received owing to damage, being blown over and sunk in this River and her Portside stove in. Portside. 5 Plates new and 2 ditto taken off made fair and rivetted. 12 frames taken out welded and replaced. Part of Bulwark plate new. 6 reversed frames shifted & butt-stopper. Side stringers in midships taken off the angle iron welded replaced and rivetted. and the Bilge stringer ditto. 5 Beam & Half Beams repaired at ends. Gunwale angle iron welded and rivetted.

New Main & Mizen Masts. 3 Jib Masts & Jib Gallant Yards Rigging refitted & parts new

Present Condition of the

cks

P.T.O.

Waterways

Comings

Upper Deck Beams & Fastenings

Lower Deck Beams & Fastenings

Planksheers

Sheerstrakes

Topsides

Wales

Plank (Bottom) and Counter

Engine Room Skylights

Coal Bunker, Openings, Lids, &c.

General Observations, Opinion as to Class, &c.

Greenails *Good*

Breasthooks and Stemson

Transoms, Pointers, and Crutches

Timbers of the Frame at the openings

Ditto Ditto at other places

Keelsons

Clamps and Shelves

Ceiling

Rudder

Copper *Good* When put on

Caulking of

Bottom, Deck, & Waterways

Windlass and Capstan

Pumps

Boats

Masts, Yards, &c.

Condition, how ascertained

Sails

Anchors No. of? *As per St. Wdgs*

Cables

Hawsers and Warps

Standing & Running Rigging

Cargo and Main Hatchways

Hatches

Scuppers

Good

Good

Good

Good

Good

Good

Good

Good

Good

Good

Good

Good

Good

Good

Good

Good

Good

Good

Summary £3-3-0

Senhouse Martindale

The Amount of Entry Fee ...

...

...

...

...

...

...

...

...

...

...

...

...

...

...

...

...

...

...

...

...

...

...

...

...

...

...

...

...

...

...

...

...

...

...

...

...

...

...

...

...

...

...

24/1/77 Special ...

...

...

...

...

...

...

...

...

...

...

...

...

...

...

...

...

...

...

...

...

...

...

...

...

...

...

...

...

...

...

...

...

...

...

...

...

...

...

...

...

...

...

Certificate (if required) ...

...

...

...

...

...

...

...

...

...

...

...

...

...

...

...

...

...

...

...

...

...

...

...

...

...

...

...

...

...

...

...

...

...

...

...

...

...

...

...

...

...

...

(Travelling Expenses, if any, £)

Committee's Minute

2nd March

1877

Character assigned

100 A

Surveyor to Lloyd's Register of British and Foreign Shipping



© 2000

Lloyd's Register Foundation

IRONL70-0364

17915 Lm

Repairs in consequence of having part of
a Sugar Cargo in and mixing with the Brigs Water.
22 Floor Plates doubled at the Middle Line in Midships.
4 New outside Plates in the plat of bottom on the Portside.
32 Wash Plates & angles to cutts on the floors
Starboardside 3 New outside Plate in the plat of bottom.
25 Wash Plate and angles to cutts on the floors

The Ship New Cemented throughout.

Additional 1 Iron Stanchion to Bedwork on each side
forward.

Senhouse Martin



© 2019

Lloyd's Register
Foundation